

## ACKNOWLEDGEMENT OF TRADITIONAL OWNERS

South Gippsland Water proudly acknowledges Aboriginal and Torres Strait Islander peoples as Australia's first inhabitants and Traditional Owners. Our operations span the Traditional Lands of the Bunurong people of the South-Eastern Kulin Nation and the Brataualung people of the Gunaikurnai Nation. We acknowledge and honour the Bunurong and Gunaikurnai as the original custodians of the land and waterways on which we rely.

We pay our deepest respects to Elders, past and present, as well as to those emerging. We acknowledge the enduring cultural, social, and spiritual connections that Aboriginal and Torres Strait Islander people maintain with Country. We recognise and value that the Traditional Owner groups have cared for and protected the lands, waterways, and seas to which they are connected for thousands of generations.

In the spirit of reconciliation, we remain committed to working in partnership with the Bunurong and Gunaikurnai peoples to ensure their ongoing contribution to the future of the water management landscape while maintaining their cultural and spiritual connections.

# 0. TABLE OF CONTENTS

1.	Introduction from the Managing Director	
2.	Regulation and standards	
3.	Characterisation of the system	6
	3.1 Source water systems and catchment management	
	3.2 South Gippsland Water supply system	
4.		
	4.1 Water treatment process overview	
	4.2 Changes in water treatment and supply conditions	
	4.3 Water treatment Monitoring and control	
	4.4 Water Treatment Issues	10
	4.5 Quality management systems and continual improvement	
	Programs and practices	
	Training highlights and trainee program	14
	Major renewals and improvements	
5.	Emergency, Incident, and Event Management	
	5.1 Incidents reported under the Safe Drinking Water Act	
	Section 22 reported events	
6.	Drinking Water Quality Standards	
	6.1 Analysis Results – Schedule 2 parameters	
	· Escherichia coli	
	total Trihalomethanes	
	Turbidity	
	Comparison of results for Schedule 2 parameters over three years	
	6.2 Analysis results - other water quality standards	
	Aesthetics	
	Comparison of results for other water quality parameters	
7.		
	7.1 Complaint overview	
	7.2 Management of complaints	
8.		
9.		
). 10		
	Appendix A: drinking Water Quality Policy Appendix B: Risk Management Plan Audit Certificate	
	Appendix C: Progress summary for 2023 drinking water Risk Management Plan Audit	
	Appendix D: Progress summary for 2020 drinking water risk management plan audit	
	appendix E: Glossary of water treatment agents and processes	
	Appendix E: Glossary of acronyms and terms used in report	

## 1. INTRODUCTION FROM THE MANAGING DIRECTOR

I am delighted to present South Gippsland Water's annual drinking water quality report for the year ending 30 June 2023. This report fulfills our obligations under section 26 of the *Safe Drinking Water Act 2003* (the Act) by providing a comprehensive overview of our water quality performance and management practices.

At South Gippsland Water, our commitment to water quality is unwavering. We maintain a robust drinking water management system aligned with the framework provided in the *Australian Drinking Water Guidelines*<sup>1</sup>. The system oversees all aspects of safe drinking water supply, including water treatment, incident response, and operational improvements.

Our drinking water management system also integrates a risk-based, catchment-to-tap monitoring program. This program ensures that the water we supply meets legislative requirements of the Act and associated Safe Drinking Water Regulations 2015 (the Regulations). Based on the results of our monitoring program for the 2022-23 fiscal year, all localities served by South Gippsland Water received fullycompliant drinking water, meeting the quality standards prescribed in the Regulations. This achievement underscores our dedication to consistent delivery of high-quality drinking water to the region.

Another notable accomplishment for the year was the successful outcome of a drinking water risk management plan audit, conducted in accordance with requirements of the Act. South Gippsland Water was found compliant across all auditable elements, further testament to our steadfast commitment to managing risk and ensuring the delivery of safe drinking water to the public.

Additional highlights include the completion of major renewal projects at both the Devon North and Poowong clear water storage basins. The projects involved the complete replacement of geomembrane linings and coverings of the basins to ensure continued protection of drinking water long into the future. Extensive planning and preparations were carried out to ensure uninterrupted supply to our valued customers during the works.

The year did present its share of challenges, including a temporary disruption in source water supply to the Leongatha water treatment plant due to a break in the supply pipeline from the Ruby Creek reservoir system. A separate incident involving an air-lock in the Poowong drinking water supply system, following planned improvement works, also raised some concerns. While both events were reported to the Department of Health in accordance with legislated requirements, they were swiftly resolved without any impact on drinking water safety.

While our foremost priority is the safety of our drinking water, we also place immense importance on customer satisfaction. We strive to meet customer expectations by delivering water that is not only safe but also enjoyable to drink. Furthermore, we are committed to offering prompt and helpful service in response to water quality concerns. To these ends, it is pleasing to note a continued downward trend in complaints in recent years.

We consider it a privilege to serve the South Gippsland community, and take great pride in delivering clean, safe drinking water to the region. I trust you will find this report informative and valuable. For further details on any of the topics presented within, please do not hesitate to contact us on 1300 851 636 or via email at sgwater@sgwater.com.au.

Robert ale

Robert Murphy Managing Director

<sup>&</sup>lt;sup>1</sup> NHMRC, NRMMC (2011) Australian Drinking Water Guidelines Paper 6 National Water Quality Management Strategy. National Health and Medical Research Council, National Resource Management Ministerial Council, Commonwealth of Australia, Canberra

## 2. REGULATION AND STANDARDS

In Victoria, the provision of drinking water to the public is governed by a comprehensive regulatory framework. Administered by the Victorian Government's health department, the framework includes the *Safe Drinking Water Act 2003* (the Act) and the Safe Drinking Water Regulations 2015, which are enacted under the Act. For fluoridated water supplies, the *Health (Fluoridation) Act 1973*, supported by the Code of practice for fluoridation of drinking water supplies (second edition) also apply.

While not a law or regulation, the Australian Drinking Water Guidelines 2011 forms part of the overall framework by defining what constitutes safe drinking water and how water quality risks should be managed.

Components of the legislative framework are described in more detail below. The documents themselves can be accessed by clicking on the title links.

#### Safe Drinking Water Act 2003

The Safe Drinking Water Act 2003, as enacted by the Parliament of Victoria, is the over-arching law that governs the supply of safe drinking water to the public.

## In outline, this Act-

(a) requires water suppliers and water storage managers to prepare and implement plans to manage risks in relation to drinking water and some types of non-potable water; and

(**b**) provides for the auditing of those plans by approved auditors; and

(c) requires water suppliers to ensure that the drinking water they supply meets quality standards specified by the regulations; and

(d) requires water suppliers to disclose to the public information concerning the quality of drinking water; and

(e) provides for the variation, after community consultation, of water quality standards that relate only to aesthetic factors; and

(f) requires the reporting of known or suspected contamination of drinking water to the Secretary to the Department of Health; and

(g) empowers the Secretary to enforce this Act.

## Safe Drinking Water Regulations 2015

The Safe Drinking Water Regulations are made under section 56 of the *Safe Drinking Water Act 2003*.

The objective of the Regulations is to make further provision for the supply of safe drinking water by—

(a) setting out further matters to be addressed in risk management plans and the risks to be addressed in those plans; and

(**b**) specifying the documents to be made available for inspection in a risk management plan audit; and

(c) specifying the issues relating to the quality of drinking water and regulated water that are to be dealt with by a water supplier and water storage manager in an annual report; and

(d) providing for other matters required to be prescribed under the Safe Drinking Water Act 2003.

## Health (Fluoridation) Act 1973

The Health (Fluoridation) Act is the law governing fluoridation in Victoria. Fluoridation is the controlled introduction of fluoride into drinking water supplies for the purpose of public dental health protection.

The Act sets out provisions for the fluoridation process, including responsibilities of water authorities, monitoring of fluoride levels, and compliance with established standards for the fluoridation of water supplies. Additionally, it outlines procedures for consultation with local communities and addresses issues related to exemptions and discontinuation of fluoridation.

## Code of practice for fluoridation of drinking water supplies (second edition) - Health (Fluoridation) Act 1973

The Code of practice for fluoridation of drinking water supplies (second edition) supports the *Health (Fluoridation) Act*. It specifies the requirements for the safe design and effective operation of a fluoridation plant.

## Australian Drinking Water Guidelines 6 2011

The Australian Drinking Water Guidelines 2011 (ADWG) serves as the authoritative reference for the Australian water industry by defining the standards for high-quality water and how to achieve them. Developed by the National Health and Medical Research Council (NHMRC) in collaboration with the National Resource Management Ministerial Council, the ADWG is subject to rolling review by the NHMRC to ensure it reflects the latest accepted science.

The ADWG offers detailed guidance on identifying and managing potential hazards to the quality of drinking water. This includes a framework to guide water suppliers in the development and continuous review of drinking water risk management plans. The ADWG also provide a comprehensive set of health-based and aesthetic water quality standards for drinking water parameters. While not mandatory by themselves, the health-based standards are the benchmarks for what constitutes safe drinking water with respect to shortand long-term risks in the Australian context.



## 3. CHARACTERISATION OF THE SYSTEM

# 3.1 Source water systems and catchment management

## Importance of catchment management

As part of South Gippsland Water's multiple barrier approach to ensuring safe drinking water, we are vigilant in monitoring for potential hazards in all our water supply catchments. This approach aligns with guiding principles of the *Australian Drinking water Guidelines 2011* (ADWG), which states that "prevention of contamination provides greater surety than removal of contaminants by treatments, so the most effective barrier is protection of source waters to the maximum degree practicable."

## **Challenges in open catchments**

Our reliance on open catchments for sourcing water presents a distinct challenge. An open catchment refers to an area where rainfall is collected on land that is privately-owned. Unlike a closed (or "protected") catchment, there is little to no restriction on land use or public access. In open catchments, complete protection of source water from run-off, including pollutants from agricultural activities, is not always achievable. Consequently, a central aspect of our role as a water supplier is to improve catchments to the fullest extent possible, both through our direct actions and via collaboration with other stakeholders.

#### **Management Programs**

Where catchment hazards cannot be prevented, they are managed with robust and reliable barriers. Examples of these measures are documented in our Drinking Water Management System. The catchment management program involves coordination of activities, including catchment surveillance, river health monitoring, land use planning assessment, and Source Water and Health-Based Target (HBT) reporting. In addition, we actively engage in treeplantings and weed control, while also promoting the importance of source water protection within the South Gippsland community through stakeholder engagement programs.

## **Catchment improvement projects**

Noteworthy for the 2022-23 fiscal year, is a significant project focussed on the Lance Creek water supply

catchment. The project aims to build upon prior assessments and identify measures to mitigate the impact of several key concerns, including:

- Occurrence of nuisance and potentially harmful cyanobacterial (blue-green algal) blooms
- Release of iron and manganese from sediments within the reservoir
- Legacy use of copper sulphate as an algaecide

The findings from these investigations will inform management options and guide improvement strategies in anticipation of a future characterised by changing climate conditions and heightened pressures on catchments.

#### **Regional Catchment Management Strategy**

South Gippsland Water actively supports the Victoria State Government's *Our Catchments, Our Communities* project through Catchment Partnership Agreements with both the West and East Gippsland Catchment Management Authorities. The agreements align with Victorian Government commitments to land, water, and biodiversity management, including the West Gippsland Regional Catchment Strategy 2021-2027.

Our collaboration with the catchment management authorities and other stakeholders aims to harmonize catchment management with our mission of providing environmentally sustainable, safe, and high-quality drinking water to our customers. We are actively engaged in initiatives such as the South Gippsland Water H2O Grants, which support riparian fencing and gully reforestation. Our ongoing support extends to other programs, such as Corner Inlet Connections Project, and recognizes the cultural significance of Traditional Landowners, the Gunaikurnai and the Bunurong communities.

#### Raw water sampling and analysis program

Monitoring of untreated source water is performed regularly at the inlets to all South Gippsland Water water treatment plants. Reservoir and upstream of reservoir sites are also sampled on periodic or asrequired basis. A summary of testing parameters and sampling frequencies is provided in Table 1.

# Table 1: RAW WATER MONITORING AT SGW WATER TREATMENT PLANTS

Parameter	Minimum sampling frequency
Escherichia coli	Weekly
Total Coliforms	Weekly
Cryptosporidium	Event-based
Giardia	Event-based
Cyanobacteria (Blue-green algae)	Weekly (external/internal)
Algae by-products (MIB/Geosmin/Saxitoxin)	Event-based
Alkalinity	Monthly
Aluminium	Quarterly
Calcium	Quarterly
Copper	Quarterly
Dissolved Organic Carbon	Quarterly
Manganese	Quarterly
Nitrogen compounds	Quarterly
Phosphorus compounds	Quarterly
Total Organic Carbon	Quarterly
Turbidity	Weekly
Pesticides	Annually/Biannually/Event- based
Radionuclides	Every 5 years: Sampling conducted in Nov. 2021

## 3.2 South Gippsland Water supply system

The service area of South Gippsland Water (SGW) covers approximately 4,000 square kilometres of the South Gippsland region, from Wonthaggi in the west to Yarram in the east; refer to Figure 1 – Map of South Gippsland Water water supply area and systems. The total water supply operation for 2022-2023 comprised:

- 1,234 square kilometres of total catchment area
- 9 reservoirs/dams and 4 raw water storage basins or tanks
- 8 water treatment plants and water supply systems
- 25 treated water distribution storages
- 18 water pumps
- 739 kilometres of water mains
- 22,950 customer connections across 22 rural centres
- 4,656 megalitres (million litres) of metered water supplied to customers
- A connection pipeline from the Melbourne water grid to the Lance Creek water treatment plant
- 19 gazetted water sampling localities

Information on South Gippsland Water water sampling localities and supply sources is presented in Table 2.

## Table 2: SOUTH GIPPSLAND WATER WATER SAMPLING LOCALITIES AND SUPPLY SOURCES

Localities supplied	Population Serviced <sup>2</sup>	Principal raw water supply sources	Supplementary water supply sources	Raw water storage	Water Treatment Plant
Alberton Yarram	710 2,570	Tarra River	Gippsland Basin groundwater aquifer (via bore, Devon North)	Devon North Raw Water Basin	Devon north
Dumbalk	460	Tarwin River (east branch)		Dumbalk Raw Water Tank	Dumbalk
Fish Creek	860	Battery Creek		Battery Creek Reservoir	Fish Creek
Foster	2,040	Deep Creek		Deep Creek Reservoir Foster Dam Foster Raw Water Basin	Foster
Cape-Paterson Inverloch Lance-Creek Wonthaggi Korumburra Loch Nyora Poowong	1,110 6,780 100 <sup>3</sup> 9,440 4,750 710 1,640 720	Lance Creek Reservoir	Potable water also received from Cardinia Reservoir and the Victorian Desalination Plant	Lance Creek Reservoir	Lance Creek
Koonwarra Leongatha	370 6,840	Ruby Creek		No.1 Reservoir No. 2 Reservoir No. 3 Reservoir (Hyland) No. 4 Reservoir (Western)	Leongatha
Meeniyan	840	Tarwin River		Meeniyan Raw Water Basin	Meeniyan
Port-Franklin Port-Welshpool Toora	170 690 820	Agnes River		Cooks Dam	Toora
Total	41,680				

<sup>&</sup>lt;sup>2</sup> Population served based on ABS 2021 Census data. The ABS method of population calculation is based on the <u>Australian Statistical Geography Standard</u> Statistical Level 2 data and may not always reflect the exact water district.

<sup>&</sup>lt;sup>3</sup> Estimate only



Figure 1: South Gippsland Water water supply area and systems

## 4. WATER TREATMENT AND QUALITY MANAGEMENT SYSTEMS

## 4.1 Water treatment process overview

Rainwater, in its natural state, is generally pure as it falls from the sky. However, when it reaches the ground and flows across the landscape into streams and rivers, it can pick up dirt, minerals, leaf matter, microorganisms, and array of other potential contaminants. Such surface water must undergo appropriate purification and disinfection processes to render it safe for human consumption. The treatment processes used at South Gippsland Water are outlined below.

#### Raw water settling and aeration

The water treatment process typically begins with the collection of rainwater from runoff and streams in a reservoir. Water collected in a reservoir is referred to as "raw water" but may also be called "source water" or "untreated water".

The reservoir serves as a settling basin where debris and large particulate matter sink to the bottom through natural gravitational forces. Some reservoirs may also incorporate aeration devices designed to oxidise and solidify dissolved substances in the water.

### **Coagulation and flocculation**

As the raw water is piped from the reservoir to the water treatment plant, chemical agents are introduced. These agents facilitate the aggregation of small particles into larger, insoluble masses in a process known as "coagulation and flocculation".

## Clarification

The resulting masses, referred to as "floc", are subsequently separated from the water in the process of "clarification". Clarification can occur through either gravitational settling (sedimentation clarification) or flotation of floc (dissolved air flotation or "DAF" clarification), depending on the specific water treatment method employed.

#### Filtration

The now clarified water then percolates through large filter beds composed of layers of granular material, including sand and gravel. The filter beds serve to further purify the water by removing remaining floc and small particles, including microorganisms.

## Disinfection

The final and crucial stage in the water treatment process is disinfection. This typically involves the addition of chlorine-based disinfectants, but other chemical agents or ultra-violet (UV) light may also be used. These disinfectants eliminate any remaining microorganisms, ensuring that water supplied to customers is safe for consumption.

A summary of the specific processes and treatment agents used at South Gippsland Water water treatment plants is provided in Table 3 and Table 4.

# 4.2 Changes in water treatment and supply conditions

There were no changes to water treatment processes or supply conditions for South Gippsland Water in the 2022-23 reporting period.

#### 4.3 Water treatment Monitoring and control

The water treatment process is subject to continual monitoring and control by inline SCADA (Supervisory control and data acquisition) systems. SCADA systems prevent the production of out-of-specification water at all stages of the process by alerting staff to potential issues and automatically shutting down plant operation when required.

To verify correct SCADA functioning and plant operation, a range of manual checks are routinely performed by water treatment plant operators. These include tests for specific water quality parameters, and calibration of on-line monitoring and chemical dosing equipment.

Water treatment plant operators also carry out jar tests in treatment plant laboratories. Jar tests allow for simulation of plant conditions so that adjustments in treatment chemical dosage can be made. This enables optimisation of the treatment process in response to seasonal changes in raw water quality and other factors.

## 4.4 Water Treatment Issues

There were no water treatment issues for South Gippsland Water in the 2022-23 reporting period.

## Table 3: PROCESSES AND CHEMICALS USED TO TREAT AND DISINFECT WATER SUPPLIED BY SGW

Water Treatment Plant (WTP)	Localities supplied	Treatment process	Treatment frequency	Added substances
Devon	Alberton	Pre-treatment pH correction	As required	Sodium carbonate
North WTP	Yarram	Manganese oxidation	As required	Sodium hypochlorite
		Coagulation and flocculation	Regular	Aluminium chlorohydrate
		Dissolved air flotation clarification	Regular	Air
		Filtration by granular medium	Regular	-
		Primary chlorination disinfection	Regular	Sodium hypochlorite
		Dewatering of waste-water	Regular	-
Dumbalk	Dumbalk	Pre-treatment pH correction	Regular	Sodium carbonate
WTP		Manganese oxidation	As required	Potassium permanganate
		Coagulation and flocculation	Regular	Aluminium chlorohydrate
		Sedimentation clarification	Regular	-
		Filtration by granular medium	Regular	-
		Ultraviolet (UV) disinfection	Regular	-
		Primary chlorination disinfection	Regular	Sodium hypochlorite
		Secondary chlorination disinfection	Regular	Sodium hypochlorite
		Volatile organics removal by aeration	Regular	-
		Dewatering of wastewater	Regular	Anionic polyacrylamide
Fish Creek	Fish Creek	Pre-treatment pH correction	Regular	Sodium carbonate
WTP		Manganese oxidation	As required	Potassium permanganate / Sodium hypochlorite
		Coagulation and flocculation	Regular	Aluminium sulphate
		Sedimentation clarification	Regular	-
		Filtration by granular medium	Regular	Anionic polyacrylamide
		Post treatment pH correction	Regular	Sodium carbonate
		Primary chlorination disinfection	Regular	Sodium hypochlorite
		Volatile organics removal by aeration	Regular	-
		Secondary chlorination disinfection	Regular	Sodium hypochlorite
		Dewatering of wastewater	Regular	-
Foster WTP	Foster	Taste and odour control	As required	Powdered activated carbon
		Pre-treatment pH correction	Regular	Sodium carbonate
		Manganese oxidation	As required	Potassium permanganate / Sodium hypochlorite
		Coagulation and flocculation	Regular	Aluminium sulphate
		Sedimentation clarification	Regular	-
		Filtration by granular medium	Regular	-
		Post treatment pH correction	Regular	Sodium carbonate
		Primary chlorination disinfection	Regular	Chlorine (gas)
		Secondary chlorination disinfection	Regular	Sodium hypochlorite
		Dewatering of wastewater	Regular	-

Table 3 continues over page...

Water Treatment Plant (WTP)	Localities supplied	Treatment process	Treatment frequency	Added substances
Lance Creek	Саре	Taste and odour control	As required	Powdered activated carbon
WTP	Paterson	Pre-treatment pH correction	As required	Sodium hydroxide / hydrochloric acid
	Inverloch	Coagulation and flocculation	As required	Aluminium Chlorohydrate
	Lance Creek	Dissolved air flotation clarification	Regular	Air
	Wonthaggi	Filtration by granular medium	Regular	-
	Korumburra Poowong Loch	Post treatment pH correction	Regular	Sodium hydroxide
		Fluoridation	Regular	Hexafluorosilicic acid
		Primary chlorination disinfection	Regular	Chlorine (gas)
1	Nyora	Secondary chloramination disinfection	Regular	Chlorine (gas) and ammonia
		Dewatering of wastewater	Regular	Anionic polyacrylamide
Leongatha	Koonwarra	Taste and odour control	As required	Powdered activated carbon
WTP	Leongatha	Pre-treatment pH correction	Regular	Sodium hydroxide
		Manganese oxidation	As required	Potassium permanganate
		Coagulation and flocculation	Regular	Aluminium sulphate
		Sedimentation clarification	Regular	-
		Filtration by granular medium	Regular	-
		Ultraviolet (UV) disinfection	Regular	-
		Post treatment pH correction	Regular	Sodium hydroxide
		Primary chlorination disinfection	Regular	Chlorine (gas)
		Secondary chlorination disinfection	Regular	Chlorine (gas)
		Dewatering of wastewater	Regular	-
Meeniyan	Meeniyan	Manganese oxidation	As required	Sodium hypochlorite
WTP		Coagulation and flocculation	Regular	Aluminium Chlorohydrate
		Sedimentation clarification	Regular	Anionic polyacrylamide
		Filtration by granular medium	Regular	-
		Primary chlorination disinfection	Regular	Sodium hypochlorite
		Ultraviolet (UV) disinfection	Regular	-
		Volatile organics removal by aeration	Regular	-
		Secondary chlorination disinfection	Regular	Sodium hypochlorite
		Dewatering of wastewater	Regular	Anionic polyacrylamide
Toora WTP	Port	Taste and odour control	As required	Powdered activated carbon
	Franklin	Pre-treatment pH correction	As required	Sodium carbonate
	Port Welshpool	Manganese oxidation	As required	Potassium permanganate / Sodium hypochlorite
	Toora	Coagulation and flocculation	Regular	Aluminium sulphate
		Sedimentation clarification	Regular	-
		Filtration by granular medium	Regular	-
		Ultraviolet (UV) disinfection	Regular	-
		Post treatment pH correction	Regular	Sodium carbonate
		Chlorination disinfection	Regular	Chlorine (gas)
		Dewatering of wastewater	Regular	-

# Table 4: PROCESSES AND CHEMICALS USED TO TREAT SUPPLEMENTARY SUPPLY FROM MELBOURNE WATER TO LANCE CLEAR WATER STORAGE

Source/water catchment	Storage/transfer	Treatment process	Treatment frequency	Added substances
Transfer from Silvan	Cardinia	Disinfection	Regular	Chlorine gas (Cl2) / Sodium hypochlorite
Reservoir without being treated at Silvan WTP	Reservoir	Fluoridation	Regular	Fluorosilicic acid (FSA)
		pH Correction	Regular	Hydrated lime (Calcium oxide)
		Secondary disinfection	Regular	Sodium hypochlorite
		Secondary pH correction	Regular	Carbon dioxide
Bass Strait sea water via Desalination Plant	Direct supply to Cardinia	Coagulation	Regular	Ferric sulphate, sulfuric acid, PolyDADMAC*
offtake	Reservoir	Filtration	Regular	-
		Reverse osmosis (salt removal)	Regular	Antiscalant, Sodium hydroxide, Sodium bisulfite
		Reverse osmosis cleaning	As required	Caustic soda, detergent, acid
		Remineralisation	Regular	Hydrated lime (Calcium dioxide), Carbon dioxide
		Fluoridation	Regular	Fluorosilicic acid (FSA)
		Disinfection	Regular	Chlorine gas (Cl2)
		Membrane preservation	As required	Sodium bisulfite
		Sludge thickening/dewatering	Regular	Polyacrylamide
		Membrane preservations	Regular	Sodium bisulphite
Melbourne Water	Transfer pipeline	pH correction	Regular	Hydrochloric acid, Sodium hydroxide
Delivery Point 5 (DP5) of desalination pipeline	from DP5 to Lance Creek clear water storage tank	Disinfection	Regular	Chlorine gas (Cl2)

 ${}^{*} {\sf Polydially dimethy lammonium chloride}$ 

# 4.5 Quality management systems and continual improvement

## PROGRAMS AND PRACTICES

South Gippsland Water's risk management approach is grounded in the Framework for Management of Drinking Water Quality as described in the Australian Drinking Water Guidelines. Integral to our drinking water risk management system are a range of ongoing programs and practices. These are designed to maintain the optimal operation of water treatment plants and water supply distribution systems. Notable examples include:

- Filter management program: ensuring effective and efficient filtering at water treatment plants.
- Backflow prevention program: safeguarding against distribution system contamination risks
- Regular storage inspections and site security checks: ensuring structural integrity of storages and fencing
- Procedures for hygienic mains repair: ensuring sanitary work practices
- Watermains cleaning programs: proactive flushing and scouring to remove sediment accumulations
- Hydrant replacement program: upgrading legacy ball hydrants to spring-loaded for enhanced supply system security
- Watermains renewal program: Upgrading and maintaining critical infrastructure.
- Contingency and resilience planning: preparing for a changing climate, and unforeseen risks.

Another essential aspect of our drinking water risk management system is our commitment to continual improvement, aiming to achieve excellence in water delivery. This dedication extends to the ongoing development of our operations and quality assurance staff through training, seminars, journal subscriptions, and membership in peak industry bodies, such as the Water Industry Operators Association (WIOA). These efforts ensure that our staff remain up-to-date with drinking water-related research, technological advancements, and industry best practice.

### TRAINING HIGHLIGHTS AND TRAINEE PROGRAM

Formal training from accredited providers is undertaken by our water treatment operators upon employment, ensuring they possess the necessary qualifications if not already certified. In the 2022-23 period, two water treatment operators commenced their Certificate III in Water Industry Treatment training.

South Gippsland Water is also committed to encouraging young people to the industry through our Operations Trainee Program. Trainees specialise in either treatment or maintenance aspects of the business but also gain a range of experiences across the organisation. In the 2022-23 period, all program graduates secured ongoing employment at South Gippsland Water.

### MAJOR RENEWALS AND IMPROVEMENTS

South Gippsland Water successfully completed several significant capital improvement projects in the 2022-23 reporting period. These included the complete renewal of the geomembrane linings and coverings for the Devon North and Poowong clear water storage basins. To ensure a continuous supply of safe drinking water to customers, meticulous planning and preparatory works were carried out, including the installation of temporary water supply tanks.

Additionally, a substantial upgrade of the Leongatha water treatment plant was completed during the year. This encompassed the installation of an advanced ultraviolet (UV) disinfection system, reconfiguration of clear water storage tanks, and the refurbishment of filtration systems.

Further details on these and other completed projects are provided in Table 5. Projects planned for the 2023-28 pricing period are also included in Table 5.



Photo: CWS Renewal works at Devon North WTP

## Table 5: Capital improvement projects - water treatment and supply

Site	Improvement project	Water quality/supply benefit	Expected completion year	Approximate expenditure \$	Status
Devon North CWS Renewal of geomembrane lining and cover		Continued protection of potable water in basin	2024	\$996,000	Complete
Foster CWS Basin	Renewal of geomembrane lining and cover	Continued protection of potable water in basin	2024	N/A	Not started. (Planned for 2024)
Foster WTP	Renewal of filters	Continued effective water treatment	2028	N/A	Commenced
Foster WTP	Upgrade of PAC dosing system	Improved control of cyanobacterial taste and odour compounds	2028	N/A	Not started. (Planned 2023-28)
Leongatha raw water transfer main	Pipe refurbishment and renewal	Improve security of source water supply to WTP by reducing risk of age-related breakage of raw water transfer main	2025	N/A	Commenced
Leongatha raw water supply system	Management improvement project	Improve accessibility of main for inspection and repair. Improve overall management of Leongatha raw water supply system	2024	N/A	In progress
Leongatha WTP	Installation of an ultraviolet (UV) disinfection system	Provides an additional disinfection barrier against pathogenic microorganisms, particularly protozoan parasites	2023	\$1,400,000	Complete
Leongatha WTP	Improvements to clear water storages configuration	Greater control of disinfectant contact times	2023	\$1,400,000	Complete
Leongatha WTP	Filter refurbishment	Continued effective water treatment	2024	N/A	Complete
Meeniyan WTP	Individual filter turbidity monitoring and control	Improved filtration monitoring and control of treatment process	2024	\$130,000	In progress
Poowong CWS Basin	Renewal of geomembrane lining and cover	Continued protection of potable water in basin	2024	\$692,000	Complete
Poowong water tower	Reconfiguration and upgrade to reduce residency time of water	Improved maintenance of monochloramine residual to protect water in tank, without need for operational intervention (flushing/scouring)	2028	N/A	In progress
Toora WTP	Upgrade of the UV disinfection system	Improved reliability of existing system, which provides an additional barrier against pathogenic microorganisms, including protozoan parasites	2023	\$70,000	Complete
Toora WTP	Renewal of the 1- ML CWS tank, including complete roof replacement	Continued protection of potable water in tank.	2024	N/A	In progress
Toora WTP	Renewal of filters	Continued effective water treatment	2028	N/A	Commenced
Toora WTP	Upgrade of PAC dosing system	Improved control of cyanobacterial taste and odour compounds	2028	N/A	Not started. (Planned 2023-28)

## 5. EMERGENCY, INCIDENT, AND EVENT MANAGEMENT

# 5.1 Incidents reported under the Safe Drinking Water Act

Section 18 Safe Drinking Water Act 2003 (the Act) requires a water supplier to notify the Department of Health ("the department" or "DH") when it becomes aware that the drinking water it is supplying to another person does not comply, or is not likely to comply, with any relevant water quality standard.

There were no issues requiring a section 18 notification for South Gippsland Water (SGW) in the 2022-23 reporting period. Section 22 of the Act requires a water supplier to immediately notify the department of any circumstances where it is suspected or believed that drinking water supplied to the public may be the cause of an illness, pose a risk to human health, or cause widespread public complaint.

In accordance with this requirement, two incidents were reported to the department in the 2022-23 reporting period.

A summary of the reported events is provided in Table 6. Detailed discussions can be found on subsequent pages.

Water sampling locality affected	Type of notification	Date of incident	Location of incident	Basis of notification	Nature of incident
Leongatha and Koonwarra	Section 22	27/8/2022 to 28/8/2022	Leongatha water treatment plant	Potential for loss of drinking water supply and system pressure, should incident not be resolved quickly.	Production of potable water was disrupted due to a break on the transfer main that supplies raw water from reservoir to treatment plant. This left supply of potable water to customers reliant on declining volume in clear water storage tanks. Difficulties in locating and accessing the break site delayed repair and caused concerns with respect to potential loss of water pressure and supply to customers. The repair and restoration of normal treatment plant production was completed before volume in clear water storage reached critical low level. Drinking water supply was unaffected and remained safe throughout the incident.
Poowong, Loch, and Nyora	Section 22	8/11/2022 to 9/11/2022	Poowong water supply system	Suspected potential for loss of system pressure.	Customer complaints of low water pressure were received following planned nightworks at Poowong clear water storage (CWS) basin. As direct cause was initially unknown, there was concern that depressurisation of Poowong distribution main may occur due to loss of water supply. Investigation found an air-lock (pocket of air trapped in the main) restricting water flow in the distribution main was the cause. Air was released and system flushed. Water quality monitoring confirmed drinking water quality and safety throughout incident.

## Table 6: SUMMARY OF EVENTS REPORTED IN ACCORDANCE WITH THE SAFE DRINKING WATER ACT 2003

#### SECTION 22 REPORTED EVENTS

## LEONGATHA RAW WATER TRANSFER MAIN BREAK

#### **INCIDENT OVERVIEW**

In the morning of Saturday, the 27<sup>th</sup> of August 2022, an incident occurred involving a significant break in the transfer main supplying raw source water from the Ruby Creek reservoir system to the Leongatha water treatment plant. The break caused a complete disruption of raw water supply to the treatment plant, and, consequently, the cessation of potable drinking water production. As a result, drinking water supply to Leongatha and Koonwarra became entirely dependent on existing volumes in clear water storage tanks.

#### **INCIDENT MANAGEMENT RESPONSE AND OBJECTIVES**

An Incident Management Team (IMT) was established to manage the incident in accordance with Emergency Management Victoria protocols. This included notification to the Department of Environment, Land, Water and Planning (DELWP). The IMT had two primary objectives: reducing water demand in Leongatha and expediting repair of the broken transfer main.

#### WATER DEMAND REDUCTIONS AND REPAIR CHALLENGES

Immediate contact was made with Saputo (a dairy processing factory) and other major customers to inform them of the incident and request their cooperation in minimising water usage. Later in the day, a comprehensive outreach campaign was launched using email, text messaging, and social media platforms to encourage water conservation by general customers. These communications resulted in a significant reduction in water usage, buying valuable time for the repair work to be carried out.

Effecting the repair proved particularly challenging, with the break first having to be located on the 3.8 kilometre-long transfer main. Once identified, heavy equipment, repair materials, and maintenance personnel were required to be mobilised across difficult farmland terrain to the break site.

#### **DEPRESSURISATION CONCERNS AND DH NOTIFICATION**

As the afternoon progressed, concerns arose about diminishing volumes in the clear water storage tanks and whether the transfer main could be repaired before critical low volume limits were reached. Such an event would lead to depressurisation of the distribution system followed by complete cessation of water supply to customers.

Loss of water pressure within water mains can lead to contamination of the system through entry of external ground water and other materials through cracks, loose joints, and ball hydrant points. Such contaminants are normally prevented from entering the system due to the outward pressure of the water flowing within water mains, hence the concern.

While conservative estimates indicated there was still several hours' worth of drinking water supply (and normal system pressure), the Department of Health (DH) was notified in accordance with section 22 of the *Safe Drinking Water Act*.

#### **P**RECAUTIONARY MEASURES AND SUCCESSFUL REPAIR

In consultation with DH, preparations were made to issue a "Do not drink" advisory to customers, should it be required. Temporary water tankers were set up at the Leongatha hospital and in the central business district of the town as pre-emptive measures. Major and Additional Needs ("vulnerable") customers were advised of the potential for drinking water advisory requirement.

The repair was completed well before critical low volume limits in clear water storage tanks were reached. The transfer main was recharged with raw water by 11:30 pm, allowing treatment plant operation to recommence.

The plant was closely monitored overnight to ensure optimal operation and recovery of clear water storage volumes. Once restoration of normal supply and drinking water quality were confirmed with DH, major and vulnerable customers were contacted to advise them of the outcome.

#### **FOLLOW-UP AND INSIGHTS**

To ensure a comprehensive understanding of the incident and identify opportunities for improvement, debrief meetings were conducted internally and separately with both DH and DELWP. From SGW's perspective, the discussions unveiled several noteworthy elements, including the successful activation of the Emergency Management Plan, an organised and efficient management approach, productive negotiations with major customers and farmer stakeholders, and the dedication and willingness of staff to assist.

Potential improvements in incident management also emerged from these discussions. It was noted that efforts should be made to build SGW's database of customer-supplied mobile phone contact details and review bulk messaging options, given the immediacy and convenience that Short Message Service (SMS) texting offers with respect to customer notification. A reassessment of on-call weekend rosters with a view to reducing reliance on staff goodwill was also recognised as an important management action going forward.

In addition to incident management, the debrief meetings served as the starting point for ongoing discussions with respect to minimising the risk of a similar transfer main break in the future and addressing accessibility challenges faced by maintenance staff during the incident. Subsequently, a major project commenced with the aims of determining the cause of the break, identifying longterm actions, and implementing appropriate interim measures.

#### **ROOT CAUSE ANALYSIS AND RISK ASSESSMENT**

A root cause analysis found that age-related weakening of the transfer main construction material contributed to the break. This rendered the main susceptible to external pressures resulting from land movement. Evidence of a land slip above the main in the area of the break was observed as was soil erosion into Ruby Creek, in the region downhill of the main.

Investigation also revealed that a 100-metre section of the transfer main in the vicinity of the break site was at risk of a repeat incident. Sections of the main where it travels above ground were similarly identified as at increased risk of breakage.

## LONG-TERM STRATEGY AND INTERIM MEASURES

A long-term strategy of pipe refurbishment and renewal has been developed in response to these risk assessments. It is anticipated that renewal works will commence in early 2024, once land survey, pressure modelling, and stakeholder consultation have been completed.

With respect to interim measures, a significant body of work has been completed and is on-going. This includes vegetation-clearing for greater accessibility to the transfer main, valve upgrades and installations for improved management of the raw water supply, and the development of maintenance, operational, and emergency response plans.

Although some risk of transfer main breakage will exist until after completion of refurbishment works, these measures, combined with insights gained through investigation, will significantly enhance response and repair times, minimising the risk of a complete system failure.



Photo: Ruby Creek reservoir system

## **POOWONG LOW WATER PRESSURE INCIDENT**

### **INCIDENT OVERVIEW**

On the morning of Tuesday, the 8<sup>th</sup> of November 2022, reports of low water pressure were received from customers in the town of Poowong. This occurrence followed the completion of planned nightworks by SGW operations personnel at the Poowong clear water service (CWS) basin.

#### **DEPRESSURISATION CONCERNS AND DH NOTIFICATION**

While it was assumed that the diminished water pressure related to the works, the specific cause was initially unknown. This raised concerns that the Poowong distribution main might completely depressurise due to a break at an unidentified location. The distribution main feeds the water tower in Poowong, as well as those in the neighbouring towns of Loch and Nyora. A number of residential and rural properties are also supplied directly from this main.

Due to the uncertain risk of depressurisation and resultant potential for contaminants to enter the main, the Department of Health was immediately notified in accordance with section 22 of the Act.

#### **INCIDENT RESPONSE ACTIONS**

An incident management team (IMT) was promptly established to coordinate response activities. These included:

- setting up temporary water tankers at key locations in Poowong
- implementation of mains flushing using high pressure water from the Poowong water tower to address any potential contamination risks
- mobilising additional staff to assist with field investigations and system flushing
- monitoring of water quality indicators in the field and collection of samples for external laboratory analysis
- Communicating with Poowong, Loch, and Nyora customers via SMS, email, social media, and website posts for assistance with reducing water demand

- preparing for issue of a boil water advisory (BWA)<sup>4</sup> for customers, in the event it would be required
- phone calls to self-registered Additional Needs customers to advise of potential for BWA.
- isolation of both Loch and Nyora water towers from the affected distribution main

## **C**AUSE AND CORRECTIVE ACTIONS

By early-afternoon, investigation determined that air had become trapped in the distribution main during the reinstatement stage of the planned nightworks. This had created an airlock that restricted the flow of water.

Flushing of the distribution main using high pressure water from the Poowong water tower was continued to facilitate the removal of trapped air through hydrant points.

## **MONITORING AND WATER QUALITY ASSURANCES**

Ongoing water quality monitoring at various representative sites in Poowong and along the distribution main towards Loch and Nyora consistently demonstrated no adverse changes in water quality. The measured levels of monochloramine and total chlorine did not indicate heightened disinfectant demand, as would be the case if contaminants had entered the system. Turbidity levels remained low and field staff reported the water's appearance as "clear and clean".

These findings provided assurance regarding the continued safety and quality of the water supply, obviating any need for a BWA.

## **RESTORATION OF NORMAL OPERATIONS**

Sequential flushing through hydrant points the entire length of the distribution main to Nyora continued into the evening. The inlets to the Loch and Nyora water towers were reopened for normal supply from the main at about 9:30 pm, following completion of the mains flushing. Customers were advised of a return to normal operation via website and social media posts.

Microbiological analysis results for samples collected from Poowong, Loch, and Nyora during the incident

<sup>&</sup>lt;sup>4</sup> A Boil Water Advisory or "BWA" is a direction for customers to boil water prior to consumption. Boiling ensures drinking water safety by killing any microorganisms ("germs") that may be present.

all confirmed drinking water quality and the incident was closed on Wednesday the 9<sup>th</sup> of November 2022.

#### **PLANNED NIGHTWORKS OVERVIEW AND ROOT CAUSE**

The purpose of the planned nightworks (that led to the incident) was to install a flow meter on the outlet of the Poowong CWS basin and make other alterations in preparation for important liner and cover renewal work in the coming months. To install the flow meter, it was necessary to isolate and dewater the section of the distribution main at the outlet of the CWS basin.

The works also necessitated a temporary reconfiguration of supply conditions within the Poowong-Loch-Nyora system. Water flow and pressure was to be maintained by direct feed from the Poowong water tower while the CWS basin was offline. Upon completion of the outlet works, the system needed to be returned to its regular configuration before the usual morning surge in customer water usage.

Given the scope and complexity of the project, a thorough risk assessment was conducted prior to commencement. This process included the development of a comprehensive work plan. Both the reconfiguration and reinstatement phases of the plan involved a coordinated program of valve operations, flow checks, flushing, and various other actions by multiple staff.

To ensure a smooth execution, a trial run was conducted on the night of Tuesday, the 11th of October 2022, one month ahead of the planned nightworks. The trial run proceeded successfully with no issues noted.

Unfortunately, on the night of the 7th-8th of November 2022, the installation works experienced slight delays due to unforeseen complications. These delays may have played a role in the development of the airlock in the distribution main.

The need to expedite reinstatement actions may have been a contributing factor, as may have early-morning customer water usage. It is possible that water demand exceeded available supply while normal flows were still re-establishing following completion of the works. This could have led to a drop in water flow rate and pressure, causing entrained air to emerge from the water as bubbles. Accumulation of air bubbles in high points of the (undulating) distribution main may have led to development of the airlock.

While air entrapment during water main works is a common occurrence, it is typically resolved by mains flushing and natural escape through air valves. Subsequent to the incident it was found that the limited number of air valves on the distribution main do not automatically release air but require manual operation. This lack of passive air release capability may have also contributed to the development of the air lock.

#### **P**REVENTATIVE ACTIONS

In response to this incident, SGW is evaluating air valve requirements on the Poowong distribution main, with a focus on improved ventilation. Procedures and training needs with respect to operation of air-valves are also under review.

## 6. DRINKING WATER QUALITY STANDARDS

During the 2022-23 reporting period, South Gippsland Water (SGW) implemented water quality monitoring programs consistent with requirements of the *Safe Drinking Water Act 2003* (the Act) and associated Safe Drinking Water Regulations 2015 (the Regulations).

Schedule 2 of the Regulations stipulates the sampling frequency and water quality standard for three water quality parameters: *Escherichia coli*, trihalomethanes (total), and turbidity. These mandatory samples must be collected from the drinking water supply at relevant frequencies and analysed for performance

against the water quality standards as shown in Table 7.

## 6.1 Analysis Results – Schedule 2 parameters

The results of analysis for Schedule 2 parameters for 2022-23 are summarised in Tables 8 to 10.

**Note:** Section 23 of the Act requires that a water supplier make available for inspection by the pubic the results of any water quality monitoring program that is conducted on any drinking water it supplies. Customers and members of the public may access drinking water quality data by telephoning South Gippsland Water Customer Service on 1300 851 636, or by emailing sgwater@sgwater.com.au

## Table 7: DRINKING WATER QUALITY STANDARDS AND REQUIRED SAMPLING FREQUENCIES AS DEFINED IN SCHEDULE 2 OF THE ACT

Parameter and relevant sampling frequency for each water sampling locality		Quality standard for each water sampling locality			
<i>Escherichia coli</i> One sample per week	water, with the For the purpos analysis condu water, if a) following	drinking water collected are found to contain no Escherichia coli per 100 millilitres of drinking e exception of any false positive sample. ses of this quality standard, <i>a false positive sample</i> means a sample that is found, after an icted in accordance with regulation 14, to contain <i>Escherichia coli</i> per 100 millilitres of drinking g the analysis, the water supplier has conducted an investigation, which has been conducted in icce with any guidelines issued by the Secretary in relation to such investigations, including any			
	timeframes for commencement and completion of the investigations, to ascertain whether the re the analysis are representative of water in the relevant sampling locality; and				
	b) the water supplier has reported the results of the investigation to the Secretary in relation to such reports, including any timeframes for provision of the report; and				
	<ul> <li>c) the investigation has concluded that the results of the analysis conducted in accordance 14 were not representative of the water in the relevant water sampling locality because established that—</li> </ul>				
	(i)	all other factors that would indicate the presence of <i>Escherichia</i> coli are not present in that water in the water sampling locality at the time of the investigation; and			
	(ii)	the drinking water treatment process applied, or other specified actions taken by the water supplier, are such as would be reasonably expected to have eliminated the presence of Escherichia coli in the water sampling locality at the relevant time; and			
	(iii)	all plant and infrastructure associated with the water treatment process were operating to specification at all relevant times; and			
	(iv)	there were no issues arising from degradation of plant or infrastructure in or around the relevant water sampling locality that could reasonably be suspected to have contributed to the presence of <i>Escherichia coli</i> in the drinking water in that water sampling locality.			
	A sample analysed in accordance with regulation 14 that is found, on that analysis, to contain <i>Escheric</i> per 100 millilitres of drinking water is not a false positive sample unless all of the circumstances in par (a), (b) and (c) apply.				
Total Trihalomethanes One sample per month	Less than or ea	qual to 0.25 milligrams per litre of drinking water			
<b>Turbidity</b> One sample per week		entile of results for samples in any 12-month period must be less than or equal to 5.0 c Turbidity Units			

## ESCHERICHIA COLI

*Escherichia coli* (*E. coli*) is an enteric (gut) bacterium. Its presence in water may indicate contamination with human or animal faecal matter and associated microorganisms and viruses – some of which may be pathogenic (disease-causing). For the quality standard for each water sampling locality to be met with respect to *E. coli*, then all samples of drinking water collected must have been found to contain no *E. coli* per 100 millilitres of drinking water, with the exception of any false positive samples (refer to Table 7 for definition of "false positive sample").

## ESCHERICHIA COLI RESULTS FOR 2022-23

Monitoring for *E. coli* for the 2022-23 reporting period was conducted in accordance with requirements of the Regulations and South Gippsland Water's risk-based monitoring program. The program specifies which sites are to be sampled and at what frequencies.

Samples for *E. coli* analysis are collected weekly from a range of different sampling sites and locations, including dedicated customers tap (water meter) sites, clear water storages (CWSs), and process water from water treatment plants. Other sites in distribution systems, such as upstream and downstream of secondary disinfection dosing units, and at the inlets and outlets CWS tanks and basins are also sampled on a weekly basis.

Compliance with the water quality standard for *E. coli* is based on monitoring of drinking water as it is supplied to customers. For some localities, this includes the results of distribution clear water storage sample analysis (where there is not a more representative site downstream of the storage) in addition to those from customer tap sample analysis.

There were no *E. coli* detections for drinking water samples collected in 2022-23 and hence all localities were compliant with the drinking water standard. Table 8 (see following page) provides a summary of *E. coli* results.

## TOTAL TRIHALOMETHANES

Trihalomethanes (THMs) are organic chemical compounds in which three of the four hydrogen

atoms of methane (CH<sub>4</sub>) are replaced by halogen atoms. The compounds may be present in drinking water principally because of chlorination or, to a much lesser extent, chloramination. Chlorine forms hypochlorous acid when added to water and can react with naturally-occurring organic material to produce the trihalomethane species trichloromethane (chloroform), bromodichloromethane, dibromochloromethane, and tribromomethane (bromoform).

The Australian Drinking Water Guidelines 2011 (ADWG) states that, "Based on health considerations, the concentration of trihalomethanes, either individually or in total, in drinking water should not exceed 0.25 mg/L. Trihalomethane concentrations fluctuating occasionally (for a day or two annually) up to 1 mg/L are unlikely to pose a significant health risk. Action to reduce trihalomethanes is encouraged, but must not compromise disinfection, as non-disinfected water poses significantly greater risk than trihalomethanes."

## TOTAL TRIHALOMETHANES RESULTS FOR 2022-23

For the year ending the 30<sup>th</sup> of June 2023, testing for trihalomethanes was conducted in accordance with the Regulations and South Gippsland Water's riskbased monitoring program. All results complied with the drinking water quality standard for trihalomethanes; results are presented in Table 9.

## TURBIDITY

Turbidity is a measurement of the light-scattering property of water which is dependent on the amount, size, and composition of fine suspended matter. The Regulations specify that the 95th percentile of results for samples in any 12-month period must be less than or equal to 5.0 Nephelometric Turbidity Units (NTU).

#### TURBIDITY RESULTS FOR 2022-23

Monitoring for compliance with the water quality standard for turbidity was conducted in accordance with the Regulations and South Gippsland Water's risk-based monitoring program. All localities were compliant with the regulatory drinking water quality standard. Turbidity results are presented in Table 10.

## Table 8: ESCHERICHIA COLI RESULTS FOR 2022-23

Water sampling locality	Customer tap samples collected per week	Clear Water Storage outlet samples collected per week	Total number of samples collected in compliance period	Maximum result (CFU/100mL) *	Number of investigations	Number of samples where standard was not met
Alberton	1	-	52	0	0	0
Cape Paterson	1	1	104	0	0	0
Dumbalk	1	1	104	0	0	0
Fish Creek	1	1	104	0	0	0
Foster	1	1	104	0	0	0
Inverloch	2	1	156	0	0	0
Koonwarra	1	-	52	0	0	0
Korumburra	1	3	208	0	0	0
Lance Creek	1	1	104	0	0	0
Leongatha	2	1	156	0	0	0
Loch	1	1	104	0	0	0
Meeniyan	1	1	104	0	0	0
Nyora	1	1	104	0	0	0
Poowong	1	2	156	0	0	0
Port Franklin	1	-	52	0	0	0
Port Welshpool	1	-	52	0	0	0
Toora	1	2	156	0	0	0
Wonthaggi	2	1	156	0	0	0
Yarram	2	2	208	0	0	0

\* Units for E. coli analysis are "Colony forming units per millilitre" (CFU/mL)

## Table 9: TRIHALOMETHANES (TOTAL) RESULTS FOR 2022-23

Water sampling locality	Customer tap samples collected per month	Clear Water Storage outlet samples collected per month	Total number of samples collected in compliance period	Average result (mg/L)	Maximum result (mg/L)	Number of samples where standard was not met
Alberton	1	0	12	0.067	0.100	0
Cape Paterson	1	0	12	0.075	0.094	0
Dumbalk	1	0	12	0.079	0.110	0
Fish Creek	1	1	24	0.144	0.230	0
Foster	1	0	12	0.100	0.150	0
Inverloch	1	0	12	0.080	0.093	0
Koonwarra	1	0	12	0.118	0.170	0
Korumburra	1	0	12	0.076	0.096	0
Lance Creek	1	0	12	0.075	0.100	0
Leongatha	1	0	12	0.109	0.150	0
Loch	1	0	12	0.053	0.065	0
Meeniyan	1	0	12	0.101	0.130	0
Nyora	1	0	12	0.072	0.095	0
Poowong	1	0	12	0.056	0.084	0
Port Franklin	1	0	12	0.089	0.110	0
Port Welshpool	1	0	12	0.064	0.081	0
Toora	1	0	12	0.073	0.084	0
Wonthaggi	1	0	12	0.076	0.094	0
Yarram	1	0	12	0.054	0.082	0

#### TABLE 10: TURBIDITY RESULTS FOR 2022-23

Water sampling locality	Customer tap sampling frequency (No. samples per week)	Total number of samples collected in compliance period	Maximum turbidity in a sample (NTU)	Maximum 95th percentile of turbidity results in any 12 months (NTU)	Number of 95th percentile of results in any 12 months above standard
Alberton	1	52	0.3	0.2	0
Cape Paterson	1	52	<0.1	0.1	0
Dumbalk	1	52	0.6	0.1	0
Fish Creek	1	52	1.2	0.2	0
Foster	1	52	0.2	0.2	0
Inverloch	2	104	0.2	0.1	0
Koonwarra	1	52	0.2	0.1	0
Korumburra	1	52	<0.1	0.1	0
Lance Creek	1	52	0.4	0.2	0
Leongatha	2	104	0.5	0.2	0
Loch	1	52	1.4	0.2	0
Meeniyan	1	52	0.2	0.1	0
Nyora	1	52	0.2	0.1	0
Poowong	1	52	0.3	0.1	0
Port Franklin	1	52	0.3	0.2	0
Port Welshpool	1	52	0.2	0.2	0
Toora	1	52	0.2	0.2	0
Wonthaggi	2	104	0.2	0.1	0
Yarram	2	104	0.5	0.1	0

## COMPARISON OF RESULTS FOR SCHEDULE 2 PARAMETERS OVER THREE YEARS

A comparison of compliance with water quality standards specified in Schedule 2 of the Safe Drinking Water Regulations 2015 in the 2022-23 period with that of the previous two fiscal years is presented in Figure 2. Consistent compliance across all South Gippsland Water water sampling localities is illustrated and in measure with the water quality standards listed for *Escherichia coli* and turbidity. A single exceedance of the drinking water quality standard for trihalomethanes in Fish Creek reduced the percentage of compliant localities to 94.7 for the 2021-22 period. Refer to the <u>2021-22 Annual Drinking</u> Water Quality Report for details.

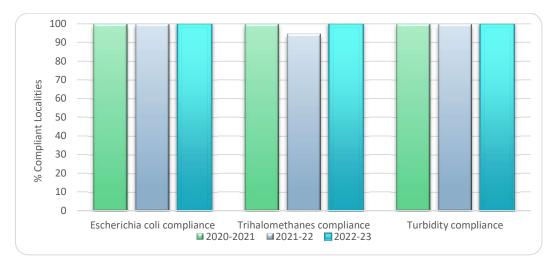


Figure 2: Percentage of localities where the drinking water complied with the water quality standards for *Escherichia coli*, trihalomethanes, and turbidity

6.2 Analysis results - other water quality standards (algal toxin, pathogen, chemical or substance that may pose a risk to human health)

As part of South Gippsland Water's drinking water quality management system, water quality parameters with potential to affect human health are monitored. These parameters are measured against standard values defined in the *Australian Drinking Water Guidelines 2011* (ADWG).

As many of these parameters do not change significantly over time or through water supply systems, frequent monitoring is not required. Results are summarised in Tables 11 to 26.

### ALUMINIUM (TOTAL)

Aluminium may be present in drinking water where aluminium salts are used as coagulants in water treatment processes to destabilise particles in water. Water quality performance with respect to aluminium was measured against the ADWG aesthetic guideline value of 0.2 mg/L. As stated in the ADWG, "no healthbased guideline is set for aluminium at this time, but this issue will be kept under review." A summary of aluminium (total) results is presented in Table 11.

### ARSENIC

Arsenic is a naturally-occurring element which can be introduced to water through dissolution of minerals and ores, or from industrial effluent, atmospheric deposition, drainage from old gold mines or the use of some types of sheep dip. The ADWG specify that, from a health perspective, the concentration of arsenic should not exceed 0.01 mg/L. Water supplied by South Gippsland Water complied with the ADWG guideline value for arsenic, with all results indicating levels were below detection limits; refer to Table 12.

#### COPPER

Copper is naturally distributed in rocks and soils. It may also be present in drinking water where aggressive waters of low pH and hardness induce corrosion of copper pipes. The ADWG specify that the concentration of copper should not exceed 1 mg/L based on aesthetic considerations, and 2 mg/L based on health considerations. Water supplied by South Gippsland Water complied with both the aestheticbased and health-based guideline values for copper; refer to Table 13.

#### LEAD

Lead may be detected in drinking water as a result of dissolution from natural sources or from household plumbing systems containing lead. The ADWG specify that, from a health perspective, the concentration of lead should not exceed 0.01 mg/L. Water supplied by South Gippsland Water complied with the ADWG guideline value; refer to Table 14.

#### MANGANESE

Manganese may be present in source waters as a result of dissolution form natural sources. Concentrations may be reduced in drinking water by converting soluble forms of the element to insoluble precipitates followed by physical removal using filtration. The ADWG specify that the concentration of manganese should not exceed 0.1 mg/L based on aesthetic considerations, and 0.5 mg/L based on health considerations. Drinking water supplied by South Gippsland Water complied with both the aesthetic and health guidelines for manganese; refer to Table 15.



Photo: SGW water sampling office

## Table 11: ALUMINIUM (TOTAL) RESULTS FOR 2022-23

Water sampling locality	Customer tap samples collected per month	Total number of samples	ADWG aesthetic guideline (mg/L)	Average result (mg/L)	Maximum result (mg/L)	Number of samples where guideline was not met
Alberton	1	12	≤0.2	<0.01	0.03	0
Cape Paterson	1	12	≤0.2	0.02	0.04	0
Dumbalk	1	12	≤0.2	<0.01	0.04	0
Fish Creek	1	12	≤0.2	0.03	0.04	0
Foster	1	12	≤0.2	<0.01	0.01	0
Inverloch	1	12	≤0.2	0.03	0.06	0
Koonwarra	1	12	≤0.2	0.02	0.03	0
Korumburra	1	12	≤0.2	0.02	0.04	0
Lance Creek	1	12	≤0.2	0.02	0.04	0
Leongatha	1	12	≤0.2	0.02	0.03	0
Loch	1	12	≤0.2	0.03	0.05	0
Meeniyan	1	12	≤0.2	0.05	0.18	0
Nyora	1	12	≤0.2	0.03	0.04	0
Poowong	1	12	≤0.2	0.02	0.04	0
Port Franklin	1	12	≤0.2	0.02	0.06	0
Port Welshpool	1	12	≤0.2	0.02	0.02	0
Toora	1	12	≤0.2	0.02	0.03	0
Wonthaggi	1	12	≤0.2	0.03	0.04	0
Yarram	1	12	≤0.2	<0.02	0.11	0

## Table 12: ARSENIC RESULTS FOR 2022-23

Water treatment plant / system	Customer tap samples collected per year	Total number of samples	ADWG health guideline (mg/L)	Result (mg/L)	Number of samples where guideline was not met
Alberton	1	1	≤0.01	<0.001	0
Cape Paterson	1	1	≤0.01	<0.001	0
Dumbalk	1	1	≤0.01	<0.001	0
Fish Creek	1	1	≤0.01	< 0.001	0
Foster	1	1	≤0.01	<0.001	0
Inverloch	1	1	≤0.01	<0.001	0
Koonwarra	1	1	≤0.01	<0.001	0
Korumburra	1	1	≤0.01	< 0.001	0
Lance Creek	1	1	≤0.01	< 0.001	0
Leongatha	1	1	≤0.01	<0.001	0
Loch	1	1	≤0.01	<0.001	0
Meeniyan	1	1	≤0.01	<0.001	0
Nyora	1	1	≤0.01	< 0.001	0
Poowong	1	1	≤0.01	<0.001	0
Port Franklin	1	1	≤0.01	<0.001	0
Port Welshpool	1	1	≤0.01	<0.001	0
Toora	1	1	≤0.01	< 0.001	0
Wonthaggi	1	1	≤0.01	<0.001	0
Yarram	1	1	≤0.01	<0.001	0

## Table 13: COPPER RESULTS FOR 2022-23

Water treatment plant / system	Customer tap samples collected per quarter	Total number of samples	ADWG aesthetic guideline (mg/L)	Average result (mg/L)	Maximum result (mg/L)	Number of samples where guideline was not met
Alberton	1	4	≤2	0.001	0.001	0
Cape Paterson	1	4	≤2	0.008	0.010	0
Dumbalk	1	4	≤2	0.006	0.010	0
Fish Creek	1	4	≤2	0.005	0.007	0
Foster	1	4	≤2	0.010	0.014	0
Inverloch	1	4	≤2	<0.006	0.009	0
Koonwarra	1	4	≤2	0.014	0.032	0
Korumburra	1	4	≤2	0.007	0.015	0
Lance Creek	1	4	≤2	0.015	0.029	0
Leongatha	1	4	≤2	0.008	0.010	0
Loch	1	4	≤2	0.022	0.033	0
Meeniyan	1	4	≤2	0.011	0.015	0
Nyora	1	4	≤2	0.006	0.010	0
Poowong	1	4	≤2	0.005	0.007	0
Port Franklin	1	4	≤2	0.002	0.003	0
Port Welshpool	1	4	≤2	0.004	0.006	0
Toora	1	4	≤2	0.008	0.011	0
Wonthaggi	1	4	≤2	0.012	0.022	0
Yarram	1	4	≤2	0.003	0.005	0

*Note:* Samples are taken for analysis from the reticulation system. Copper levels may be higher at the customers' internal taps if copper plumbing is used in the domestic system. Customers experiencing blue copper staining of fixtures or discolouration of water are advised to call South Gippsland Water Customer Service on 1300 851 636.

Table 14: LEAD RESULTS FOR 2022-23	
------------------------------------	--

Water sampling locality	Customer tap samples collected per quarter	Total number of samples	ADWG health guideline (mg/L)	Average result (mg/L	Maximum result (mg/L)	Number of samples where standard was not met
Alberton	1	4	≤0.01	< 0.001	<0.001	0
Cape Paterson	1	4	≤0.01	< 0.001	<0.001	0
Dumbalk	1	4	≤0.01	< 0.001	<0.001	0
Fish Creek	1	4	≤0.01	< 0.001	<0.001	0
Foster	1	4	≤0.01	<0.001	<0.001	0
Inverloch	1	4	≤0.01	<0.001	<0.001	0
Koonwarra	1	4	≤0.01	< 0.001	<0.001	0
Korumburra	1	4	≤0.01	< 0.001	<0.001	0
Lance Creek	1	4	≤0.01	< 0.001	<0.001	0
Leongatha	1	4	≤0.01	< 0.001	<0.001	0
Loch	1	4	≤0.01	< 0.001	<0.001	0
Meeniyan	1	4	≤0.01	< 0.001	<0.001	0
Nyora	1	4	≤0.01	< 0.001	<0.001	0
Poowong	1	4	≤0.01	< 0.001	<0.001	0
Port Franklin	1	4	≤0.01	< 0.001	<0.001	0
Pt Welshpool	1	4	≤0.01	< 0.001	<0.001	0
Toora	1	4	≤0.01	< 0.001	<0.001	0
Wonthaggi	1	4	≤0.01	< 0.001	<0.001	0
Yarram	1	4	≤0.01	< 0.001	< 0.001	0

## Table 15: MANGANESE RESULTS FOR 2022-23

Water sampling locality	Frequency of sampling (samples per month)	Total number of samples	ADWG health guideline (mg/L)	Average result (mg/L	Maximum result (mg/L)	Number of samples where standard was not met
Alberton	1	12	≤0.5	0.002	0.006	0
Cape Paterson	1	12	≤0.5	0.003	0.005	0
Dumbalk	1	12	≤0.5	0.001	0.001	0
Fish Creek	1	12	≤0.5	0.002	0.004	0
Foster	1	12	≤0.5	<0.001	0.003	0
Inverloch	1	12	≤0.5	0.003	0.009	0
Koonwarra	1	12	≤0.5	0.003	0.004	0
Korumburra	1	12	≤0.5	0.003	0.008	0
Lance Creek	1	12	≤0.5	<0.002	0.006	0
Leongatha	1	12	≤0.5	0.004	0.008	0
Loch	1	12	≤0.5	0.003	0.008	0
Meeniyan	1	12	≤0.5	<0.001	0.001	0
Nyora	1	12	≤0.5	<0.003	0.008	0
Poowong	1	12	≤0.5	0.003	0.007	0
Port Franklin	1	12	≤0.5	<0.010	0.082	0
Pt Welshpool	1	12	≤0.5	<0.003	0.008	0
Toora	1	12	≤0.5	0.005	0.017	0
Wonthaggi	1	12	≤0.5	0.004	0.010	0
Yarram	1	12	≤0.5	0.002	0.006	0

# CHLORINE DISINFECTION RESIDUAL (FREE OR TOTAL CHLORINE)

Disinfection is a critical part of water treatment. Not all microorganisms can be removed during clarification and filtration processes, so an additional disinfection step is required to ensure drinking water safety. Chlorine and chloramine (compounds formed from chlorine and ammonia) are the most commonly used agents. These are applied in carefully controlled dosages at treatment plants in the process known as primary disinfection.

The actual amount of disinfection agent dosed is very small (comparable to about a cup's worth in an Olympic-sized swimming pool). It is just adequate to both inactivate microorganisms that have made it through the purification process, and to confer a disinfection residual on the water. The residual helps to protect water as it passes through the pipes and storages of the distribution system. Chlorine and, to a lesser extent, chloramine tend to dissipate with time and distance through a water supply network so secondary dosing units may be used to ensure water remains protected to the ends of the system.

Disinfection agent dosing is automatically controlled by on-line monitoring systems which shut-down treatment plant operation in the event of levels being either too low or too high. This prevents out-ofspecification water from being produced while the problem is addressed.

With these controls in place, water supplied to customers is unlikely to ever exceed the ADWG guideline. The main purpose of disinfection residual monitoring is to ensure that it remains at an adequate level throughout the distribution system. There is no guideline for minimum disinfection residual and what is considered acceptable is particular to an individual water supply system based on its size and components, as well as the results of microbiological monitoring results.

SGW uses both chlorine and chloramine disinfection. Chlorine dissociates in water to form 'free chlorine', which consists of aqueous molecular chlorine, hypochlorous acid and hypochlorite ion. Free chlorine is monitored in the reticulation systems of chlorinated supplies on a (minimum) weekly basis during routine sampling. For the chloraminated supplies, 'total chlorine' is monitored. Total chlorine is the sum of chlorine in combined form (with ammonia and other nitrogenous or organic compounds) and free chlorine.

Based on health considerations, the ADWG guideline value for total chlorine in drinking water is 5 mg/L. There is no specific guideline for free chlorine; however, in chlorinated systems the level of free chlorine approximates or is lower than the level of total chlorine. As both total and free chlorine levels are well below 5 mg/L, all localities can be assumed to be compliant with the water quality guideline for total chlorine; refer to Table 16 and Table 17.

## CYANOGEN CHLORIDE

Cyanogen chloride is a by-product of chloramination that is formed through the reaction between organic precursors with hypochlorous acid in the presence of the ammonium ion. Based on health considerations, the ADWG specify that the concentration of total cyanogenic compounds in drinking water should not exceed 0.08 mg/L.

Monitoring of the chloraminated Lance Creek system confirmed that water supplied by SGW complied with the guideline value for cyanogen chloride, with all results indicating levels were below the detection limit; refer to Table 18.

### NITROSODIMETHYLAMINE (NDMA)

N-Nitrosodimethylamine (NDMA) is produced as a byproduct of the chloramination of drinking water due to the oxidation of natural organic matter by chlorine in the presence of ammonia. The ADWG specify that, based on health considerations, the concentration of NDMA in drinking water should not exceed 0.0001 mg/L (100 ng/L).

Monitoring of chloraminated systems for NDMA was conducted annually, with results indicating water supplied by South Gippsland Water complied with the guideline value for NDMA; refer to Table 19.

#### NITRATE AND NITRITE

Nitrates and nitrites are naturally-occurring oxides of nitrogen. Nitrite is rapidly oxidised to nitrate and is seldom present in well-oxygenated or chlorinated supplies. Chloramination disinfection can lead to nitrate and nitrite formation in the distribution system due to the action of nitrifying bacteria. The ADWG specify that, from a health perspective, the concentrations of nitrate and nitrite should not exceed 50 mg/L and 3 mg/L respectively.

Monitoring for oxidised nitrogen (nitrate plus nitrite) was conducted on a quarterly basis in chlorinated SGW systems in 2022-23. The standard of 50 mg/L for nitrate was used to measure water quality performance for oxidised nitrogen given nitrite's rapid conversion to nitrate. Based on nitrification risk, more frequent specific analysis for both nitrate and nitrite was conducted in the chloraminated localities. All the chloraminated localities complied with the specific guideline values for nitrate and nitrite; refer to Tables 20, 21, and 22.

## Table 16: FREE CHLORINE FOR 2022-23 (CHLORINATED LOCALITIES)

Water treatment plant / system	Minimum customer tap samples collected per week	Total number of samples	Minimum result (mg/L)	Average result (mg/L)	Maximum result (mg/L)	Number of samples where guideline (for Total Chlorine) was not met
Alberton	1	52	0.56	0.99	1.50	0
Dumbalk	1	52	0.02	0.39	0.92	0
Fish Creek	1	52	0.02	0.44	1.04	0
Foster	1	52	0.03	0.46	1.11	0
Koonwarra	1	52	0.00	0.15	0.57	0
Leongatha	2	104	0.03	0.65	1.24	0
Meeniyan	1	52	0.02	0.51	1.20	0
Port Franklin	1	52	0.02	0.46	0.92	0
Port Welshpool	1	90	0.27	0.97	1.57	0
Toora	1	52	0.38	0.90	1.31	0
Yarram	2	104	0.79	1.19	1.58	0

## Table 17: TOTAL CHLORINE FOR 2022-23 (CHLORAMINATED LOCALITIES)

Water treatment plant / system	Minimum customer tap samples collected per week	Total number of samples	Minimum result (mg/L)	Average result (mg/L)	Maximum result (mg/L)	Number of samples where guideline was not met
Cape Paterson	1	52	0.01	0.57	1.68	0
Inverloch	2	114	0.55	1.68	2.80	0
Korumburra	1	63	0.15	1.61	2.30	0
Lance Creek	1	52	1.85	2.68	2.98	0
Loch	1	64	0.03	0.68	1.53	0
Nyora	2	115	0.06	1.15	2.20	0
Poowong	1	52	0.07	0.76	1.95	0
Wonthaggi	2	104	0.06	1.48	2.80	0

#### Table 18: CYANOGEN CHLORIDE RESULTS FOR 2022-23 (CHLORAMINATED SYSTEMS)

Water treatment plant / system	Locality supplied	Samples collected per year*	Total number of samples	ADWG health guideline (mg/L)	Maximum result (mg/L)	Number of samples where guideline was not met
	Cape Paterson		2	<0.009	<0.05	0
	Inverloch					
	Korumburra					
Lance Creek	Lance Creek	3				
Lance Creek	Loch		3	≤0.008		
	Nyora					
	Poowong					
	Wonthaggi					

### Table 19: NDMA for 2022-23 (CHLORAMINATED SYSTEMS)

Water treatment plant / system	Locality supplied	Samples collected per year*	Total number of samples	ADWG health guideline (mg/L)	Maximum result (mg/L)	Number of samples where guideline was not met
	Cape Paterson			-0.001	<0.05	0
	Inverloch		2			
	Korumburra					
Lance Creek	Lance Creek	3				
Lance Creek	Loch	- 3	3	≤0.001		
	Nyora					
	Poowong					
	Wonthaggi					

\*Samples for cyanogen chloride and NDMA analysis are taken from the localities of Cape Paterson, Nyora, and Poowong only. These localities represent the outer reaches of the Lance Creek distribution system and maximum potential for development of disinfection byproducts due to extended residence time within the system.

## Table 20: OXIDISED NITROGEN (NITRATE +NITRITE) FOR 2022-23 (CHLORINATED SUPPLIES)

Water treatment plant / system	Localities supplied	Sampling frequency (samples per quarter)	Total number of samples	Minimum Result (mg/L)	Maximum Result mg/L	Number of samples where standard was not met
Devon Nth	Alberton Yarram	1	4	0.46	1.20	0
Dumbalk	Dumbalk	1	4	0.02	1.30	0
Fish Creek	Fish Creek	1	4	0.24	0.86	0
Foster	Foster	1	4	0.05	0.22	0
Leongatha	Leongatha Koonwarra	1	4	0.20	1.10	0
Meeniyan	Meeniyan	1	4	0.10	0.89	0
Toora	Port Franklin Port Welshpool Toora	1	4	0.18	1.00	0

## Table 21: NITRATE FOR 2022-23 (CHLORAMINATED LOCALITIES)

Water sampling locality	Minimum samples collected per month	Total number of samples	Minimum result (mg/L)	Maximum result (mg/L)	Number of samples where guideline was not met
Cape Paterson	1	12	0.027	1.20	0
Inverloch	1	12	0.120	1.20	0
Korumburra	2	24	0.082	1.20	0
Lance Creek	1	12	0.092	1.22	0
Loch	1	12	0.280	1.30	0
Nyora	2	24	0.130	1.30	0
Poowong	1	12	0.091	1.20	0
Wonthaggi	1	12	0.110	1.20	0

## Table 22: NITRITE FOR 2022-23 (CHLORAMINATED LOCALITIES)

Water sampling locality	Minimum samples collected per month	Total number of samples	Minimum result (mg/L)	Maximum result (mg/L)	Number of samples where guideline was not met
Cape Paterson	1	12	0.006	0.290	0
Inverloch	1	12	0.005	0.170	0
Korumburra	2	24	<0.002	0.270	0
Lance Creek	1	12	0.002	0.005	0
Loch	1	12	0.003	0.300	0
Nyora	2	24	<0.002	0.070	0
Poowong	1	12	<0.002	0.006	0
Wonthaggi	1	12	<0.002	0.011	0

#### FLUORIDE

Naturally-occurring fluoride concentrations in drinking water are dependent on the type of soil and rock through which source water drains. Fluoride may also be added to drinking water supplies as a public health measure for the prevention of dental decay. The ADWG specify that the maximum concentration of fluoride in drinking water should not exceed 1.5 mg/L. Under section 4 (3) of the *Health (fluoridation) Act 1973,* fluoride added to drinking water must not result in an average optimum concentration in excess of one part per million parts of water (1.0 mg/L).

## FLUORIDE MONITORING

Monitoring of non-fluoridated drinking water is conducted annually to verify continued low levels of naturally-occurring fluoride, as have been recorded historically. Results of fluoride monitoring for nonfluoridated supplies are provided in Table 23. For the fluoridated supply system of Lance Creek, monitoring is conducted in accordance with the Code of practice for fluoridation of drinking water supplies (second edition). Refer to Table 24 for results.

## FLUORIDATION OBLIGATIONS

Under the Health (fluoridation) Act, an obligation is imposed on suppliers of fluoridated water to achieve a fluoride dose rate that confers a dental health benefit on consumers. The optimal operating target dose rate is specified by the Department of Health and is based on maximum daily air temperature (which has been shown to correlate closely with water consumption). For the South Gippsland region, the optimal fluoride dosage for conferring a dental health benefit is 0.9 plus or minus 0.1 milligrams per litre (i.e., the target is a range where concentrations of 0.8 to 1.0 milligrams per litre are acceptable). South Gippsland Water fulfilled this obligation for the 2022-23 reporting period.

#### Table 23: FLUORIDE RESULTS FOR NON-FLUORIDATED SUPPLIES IN 2022-23

Water treatment plant / system	Locality supplied	Samples collected per year	Total number of samples collected	ADWG health mg/L	Result (mg/L)	No. of samples where guideline was not met
Devon North	Alberton	1	1	≤1.5	0.06	0
Devon North	Yarram	T				0
Dumbalk	Dumbalk	1	1	≤1.5	0.10	0
Fish Creek	Fish Creek	1	1	≤1.5	<0.05	0
Foster	Foster	1	1	≤1.5	0.06	0
Leongatha	Leongatha	1	1	≤1.5	0.06	0
	Koonwarra			≤1.5	0.06	0
Meeniyan	Meeniyan	1	1	≤1.5	0.09	0
	Pt Franklin					
Toora	Pt Welshpool	1	1	≤1.5	<0.05	0
	Toora					

#### Table 24: FLUORIDE RESULTS FOR FLUORIDATED SUPPLY IN 2022-23

Water sampling locality	Customer tap samples collected per week	Total Number of samples	Fluoridation standard for rolling annual average* mg/L	ADWG health guideline (mg/L)	Operating target range mg/L	Average result mg/L	Maximum result mg/L	No. of samples where standard was not met
Cape Paterson	1	52	≤1	≤1.5	0.9±0.1	0.82	0.98	0
Inverloch	1	52	≤1	≤1.5	0.9±0.1	0.82	0.99	0
Korumburra	1	52	≤1	≤1.5	0.9±0.1	0.83	0.99	0
Lance Creek	1	52	≤1	≤1.5	0.9±0.1	0.81	1.00	0
Loch	1	52	≤1	≤1.5	0.9±0.1	0.82	0.99	0
Nyora	1	52	≤1	≤1.5	0.9±0.1	0.82	1.00	0
Poowong	1	52	≤1	≤1.5	0.9±0.1	0.83	0.99	0
Wonthaggi	1	52	≤1	≤1.5	0.9±0.1	0.83	0.98	0

\* Note: under s. 5(3) of the Health (Fluoridation) Act 1973 fluoride added to drinking water must not result in an average optimum concentration in excess of one part fluoride per million parts of water.

#### OTHER INORGANIC CHEMICALS

Inorganic chemicals may be present in water as a result of the natural dissolution of rocks, soils and some plants, or through contamination from industrial and agricultural sources. Materials used to coat pipes and plumbing fittings may also be sources of inorganic chemicals in drinking water. Monitoring of all water supply systems was conducted to verify compliance with ADWG health-related guidelines for chemical concentrations as specified in Table 25.

#### OTHER ORGANIC CHEMICALS

Potential sources of contamination of the drinking water supply with organic chemicals are industrial effluent, run-off from agricultural land, and the use of pesticides and herbicides. Organic disinfection byproducts, such as the chloroacetic acids, can also form as result of disinfection processes. Consistent with historical data, monitoring of raw water intakes, distribution entry point water or customer tap sites found that levels of organic chemicals were compliant with the ADWG health-related guidelines for the 2022-23 period; refer to Table 26.

#### Table 25: OTHER INORGANIC CHEMICALS FOR 2022-23

Parameter	Sampling frequency	Number of samples per water system/locality*	Total Number of samples	ADWG guideline value (mg/L)	Maximum results (mg/L)	Number of samples where standard was not met
Antimony	Annually	one per locality	19	≤0.003	<0.001	0
Barium	Annually	one per locality	19	≤2	0.029	0
Beryllium	Annually	one per locality	19	≤0.06	<0.001	0
Boron	Annually	one per locality	19	≤4	0.06	0
Cadmium	Annually	one per locality	19	≤0.002	<0.0002	0
Chromium	Annually	one per locality	19	≤0.05	<0.001	0
Cobalt	Annually	one per locality	19	-	<0.001	0
Cyanide	Annually	one per system	8	≤0.08	<0.005	0
Mercury	Annually	one per locality	19	≤0.001	<0.0001	0
Molybdenum	Annually	one per locality	19	≤0.05	<0.001	0
Nickel	Annually	one per locality	19	≤0.02	<0.001	0
Selenium	Annually	one per locality	19	≤0.01	<0.001	0
Silver	Annually	one per locality	19	≤0.1	<0.001	0
Sulphate	Quarterly	one per system	32	≤500	58	0
Zinc	Annually	one per locality	19	≤3	0.009	0

\*Note: Monitoring may be conducted at the entry point to distribution systems or at customer tap sites in each locality dependent on likelihood of change in level of chemical as it passes through the water supply system.

### Table 26: OTHER INORGANIC CHEMICALS FOR 2022-23

Parameter	Sampling frequency (samples per year per system or locality)	Number of samples per water supply system/locality*	Total Number of samples	ADWG Guideline value mg/L	Maximum results mg/L	Number of samples where guideline was not met
1,1-dichloroethane	1	One per system	8	а	<0.001	-
1,2-dichloroethane	1	One per system	8	≤0.003	<0.001	0
2,4,5-T	1	One per system	8	≤0.1	<0.00001	0
2,4,5-TP	1	One per system	8	b	<0.00001	-
2,4,6-T	1	One per system	8	b	<0.0001	-
2,4,6-trichlorophenol	1	One per system	8	≤0.02	<0.001	0
2,4-D	1	One per system	8	≤0.03	<0.00005	0
2,4-DB	1	One per system	8	b	<0.00001	-
2,4-DP	1	One per system	8	b	<0.00001	-
2,6-D	1	One per system	8	b	<0.0001	-
4-Chlorophenoxyacetic Acid	1	One per system	8	b	<0.00001	-
Atrazine	1	One per system	8	≤0.02	<0.002	0
Benzene	1	One per system	8	≤0.001	< 0.001	0
Benzo(a)pyrene	1	One per system**	4	≤0.00001	<0.00002	0
Total PAH	1	One per system**	4	b	<0.00001	-
Carbon tetrachloride	1	One per system	8	≤0.003	<0.001	0
Chloroacetic acid	1	One per locality	19	≤0.15	<0.005	0
Clopyralid	1	One per system	8	≤2	<0.00005	0
Dicamba	1	One per system	8	≤0.1	<0.00001	0
Dichloroacetic acid	1	One per locality	19	0.1	0.034	0
Fluoroxypyr	1	One per system	8	b	<0.00005	-
Glyphosate	1	One per system	8	≤1	<0.03	0
МСРА	1	One per system	8	≤0.04	0.00005	0
МСРВ	1	One per system	8	b	<0.00001	-
Mecoprop	1	One per system	8	b	<0.00001	-
Metsulfuron methyl	1	One per system	8	≤0.04	<0.0001	0
Pentachlorphenol	1	One per system	8	≤0.01	<0.001	0
Picloram	1	One per system	8	≤0.3	<0.00005	0
Prometryn	1	One per system	8	b	<0.002	-
Simazine	1	One per system	8	≤0.02	<0.002	0
Tetrachloroethene	1	One per system	8	≤0.05	<0.001	0
Trichloroacetic acid	1	One per locality	19	≤0.1	0.032	0
Triclopyr	1	One per system	8	≤0.02	< 0.00001	0

#### Table notes:

a Insufficient data to set an ADWG guideline value based on health considerations

b No ADWG information available

\* Monitoring is conducted at raw water inlets to WTPs or at clear water storage outlets to distribution systems

\*\* Monitoring conducted at Devon North, Lance Creek and Leongatha water treatment plants only

#### AESTHETICS

South Gippsland Water strives to provide drinking water that is consistently clear and pleasant to drink for all customers. Actions taken to manage aesthetic characteristics include:

- Optimisation of treatment processes to minimise levels of iron, manganese, and organic compounds in supplied water
- pH adjustment of treated water
- Regular flushing and air-scouring to remove sediment accumulation in water mains
- Frequent sampling and analysis for aesthetic parameters
- Monitoring and management of cyanobacterial ('algal') blooms in raw water reservoirs
- Monitoring when required for compounds that may impart unpleasant tastes and odours to drinking water

Individual aesthetic characteristics are discussed below; analysis results are summarised in Tables 27 to 32.



#### COLOUR

Water may appear coloured due to the presence of natural organic substances including humic and fulvic acids, and dissolved inorganics, such as iron and manganese. Based on aesthetic considerations, the ADWG specifies that colour should not exceed 15 Hazen Units (HU). Water supplied by South Gippsland Water complied with the guideline value for colour; refer to Table 27.

#### IRON

Iron is present in source waters due to dissolution of soil and rock. High iron concentrations in drinking water can occur through rusting of iron pipes and fittings. Based on aesthetic considerations, the ADWG specify that the concentration of iron should not exceed 0.3 mg/L. Water supplied by South Gippsland Water complied with the guideline value for iron; refer to Table 28.

#### ΡН

The property of pH relates to the hydrogen ion concentration of water. pH is measured on a logarithmic scale from 0 to 14. A pH of 7 is neutral, a pH greater than 7 is alkaline, and a pH less than 7 is acidic.

To reduce corrosion and encrustation in pipes and fittings, the ADWG specifies that the pH of drinking water should be between 6.5 and 8.5. The ADWG also states that new concrete tanks and cement-mortar lined pipes can significantly increase pH and a value up to 9.2 may be tolerated, provided monitoring indicates no deterioration in microbiological quality.

The reference to microbiological quality is made in the ADWG because the disinfecting power of chlorine in chlorinated systems is greatest at lower pH and gradually declines as pH increases. Significant impairment of chlorine disinfection occurs above pH 8.0. The results for pH in chlorinated systems are provided in Table 29.

All but three chlorinated localities complied with the aesthetic guideline range of 6.5 to 8.5 One sample from Yarram, two samples from Alberton, and one from Port Franklin recorded pH values above this range but within the upper tolerance limit of 9.2 The increase in pH can be attributed to low water usage in the sample site locations and supply from cementmortar lined mains. Mains flushing was carried out to remove aged water from the system in response to each separate incidence. There were no indicators of microbiological deterioration in relation to the elevated pH values. The chemistry (and the effect of pH) for chloramination disinfection differs from that of chlorination. A higher pH is beneficial in a chloraminated system as it slows the natural decay of monochloramine and prevents the formation of dichloramine and trichloramine, which can cause unpleasant tastes and odours.

The pH results for chloraminated localities is provided in Table 30. All localities complied with the aesthetic guideline for pH.

#### HARDNESS

Hardness is a measure of the concentration of calcium and magnesium ions in water. To minimise undesirable build-up of scale in hot water systems, the ADWG specifies that total hardness of drinking water should not exceed 200 milligrams per litre of calcium carbonate\*. Water supplied by South Gippsland Water complied with the guideline value for hardness; refer to Table 31.

#### ALKALINITY

Alkalinity is defined as the quantitative capacity of an aqueous solution to neutralise an acid. In simpler terms, it is a measure of how easily the pH of water can be changed. Alkalinity is mainly determined by the levels of carbonate, bicarbonate and hydroxyl anions (negatively-charged ions) present. The property of alkalinity has a strong influence on what is referred to as water stability, which is the tendency of water to be corrosive, stable, or scale-forming on contact with surfaces.

Water stability is complex and influenced by several factors, but in general soft water of low pH and low alkalinity will tend to corrode surfaces. Highly corrosive (aggressive) water is not desirable in that it can lead to the leaching of copper and other metals from pipes and plumbing fittings.

In contrast, hard water of high pH and high alkalinity will tend to deposit calcium carbonate (form scale) on pipes, plumbing fittings, and hot water systems. While encrustation of pipes and fittings is not desirable, a thin layer of calcium carbonate can be beneficial in that it provides protection against corrosion in conditions of changing water stability.

There are no specific standards for alkalinity in drinking water but as this property provides

resistance against changes in pH that can lead to either corrosion or excessive encrustation, a reasonable level should be maintained in drinking water supplies. What is reasonable for a particular type of water will depend upon its other characteristics of pH and hardness, but a value in the range of 50 to 200 milligrams per litre of calcium carbonate \*(refer to note below for definition of unit) is generally considered optimal. Results of alkalinity monitoring are provided in Table 32.

#### \*EXPLANATORY NOTE ON UNITS USED TO EXPRESS BOTH ALKALINITY AND HARDNESS PROPERTIES

The unit of concentration "calcium carbonate equivalent", expressed as "milligrams per litre of calcium carbonate" (or mg/L CaCO<sub>3</sub>) is commonly used in water chemistry to describe aggregate properties, such as hardness and alkalinity. This is because these properties are caused by various dissolved minerals, primarily calcium and magnesium for hardness, and bicarbonate and carbonate for alkalinity. However, the minerals can exist in different forms and combinations, making it complex to measure and compare their concentrations directly.

To simplify this, calcium carbonate--which is a common compound that is easy to measure and understand--is used as a standard reference. Consequently, when a value is expressed as "mg/L CaCO<sub>3</sub>", it denotes the extent of hardness or alkalinity in the water, assuming all the various minerals were in the form of calcium carbonate. This convention simplifies the understanding and comparison of water quality data.

#### Table 27: TRUE COLOUR RESULTS FOR 2022-23

Water treatment plant / system	Localities supplied	Minimum samples collected per quarter	Total number of samples collected in reporting period	Average result (HU)	Maximum result (HU)	Number of samples where guideline was not met
Devon North	Alberton Yarram	1	4	<2	<2	0
Dumbalk	Dumbalk	1	4	<2	<2	0
Fish Creek	Fish Creek	1	4	<2	<2	0
Foster	Foster	1	4	<2	<2	0
Lance Creek	Cape Paterson Inverloch Korumburra Lance Creek Loch Nyora Poowong Wonthaggi	1	4	<2	<2	0
Leongatha	Leongatha Koonwarra	1	4	<2	4	0
Meeniyan	Meeniyan	1	4	<2	<2	0
Toora	Port Franklin Port Welshpool Toora	1	4	<2	<2	0

#### Table 28: IRON RESULTS FOR 2022-23

Water sampling locality	Frequency of sampling (samples per quarter)	Total number of samples	Minimum result mg/L	Maximum result mg/L	Number of samples where guideline was not met
Alberton	1	4	<0.01	<0.01	0
Cape Paterson	1	4	<0.01	<0.01	0
Dumbalk	1	4	0.01	0.03	0
Fish Creek	1	4	0.01	0.03	0
Foster	1	4	<0.01	<0.01	0
Inverloch	1	4	0.01	0.01	0
Koonwarra	1	4	<0.01	<0.01	0
Korumburra	1	4	0.01	0.02	0
Lance Creek	1	4	<0.01	<0.01	0
Leongatha	1	4	<0.01	<0.01	0
Loch	1	4	0.01	0.02	0
Meeniyan	1	4	<0.01	<0.01	0
Nyora	1	4	<0.01	0.02	0
Poowong	1	4	<0.01	0.03	0
Port Franklin	1	4	<0.01	<0.01	0
Port Welshpool	1	4	<0.01	<0.01	0
Toora	1	4	<0.01	<0.01	0
Wonthaggi	1	4	<0.01	<0.01	0
Yarram	1	4	<0.01	0.03	0

#### Table 29: PH RESULTS FOR CHLORINATED SYSTEMS IN 2022-23

Water sampling locality	Minimum frequency of sampling (samples per week)	Total number of samples	Minimum result pH	Mean result pH	Maximum result pH	Number of samples not compliant with aesthetic guideline
Alberton	1	52	7.8	8.4	9.1	2
Dumbalk	1	52	7.8	8.1	8.3	0
Fish Creek	1	52	7.5	7.8	8.1	0
Foster	1	52	7.4	7.7	8.0	0
Koonwarra	1	52	7.2	7.5	7.9	0
Leongatha	2	104	7.2	7.5	7.9	0
Meeniyan	1	52	7.2	7.7	7.9	0
Port Franklin	1	52	7.5	8.1	9.0	1
Port Welshpool	1	52	7.2	7.7	8.0	0
Toora	1	52	7.2	7.6	8.0	0
Yarram	1	52	7.4	7.9	8.6	1

#### Table 30: PH RESULTS FOR CHLORAMINATED LOCALITIES IN 2022-23

Water sampling locality	Minimum frequency of sampling (samples per week)	Total number of samples	Minimum result pH	Mean result pH	Maximum result pH	Number of samples not compliant with aesthetic guideline
Cape Paterson	1	52	7.6	8.0	8.3	0
Inverloch	2	114	7.8	8.1	8.3	0
Korumburra	1	63	7.6	8.1	8.5	0
Lance Creek	1	52	7.6	8.1	8.3	0
Loch	1	65	7.8	8.1	8.4	0
Nyora	1	67	7.6	8.1	8.5	0
Poowong	1	57	7.7	8.0	8.3	0
Wonthaggi	2	107	7.5	8.1	8.4	0

#### Table 31: TOTAL HARDNESS IN CALCIUM CARBONATE (CACO3) EQUIVALENTS\* 2022-23

Water treatment plant / system	Localities supplied	Sampling frequency (samples per quarter)	Total number of samples	Minimum result (mg/L as CaCO3) *	Average result (mg/L as CaCO <sub>3</sub> ) *	Maximum result (mg/L as CaCO <sub>3</sub> ) *	Number of samples where guideline was not met
Devon North	Alberton Yarram	1	4	24	26	31	0
Dumbalk	Dumbalk	1	4	56	87	130	0
Fish Creek	Fish Creek	1	4	28	30	32	0
Foster	Foster	1	4	38	39	40	0
Lance Creek	Cape Paterson Inverloch Korumburra Lance Creek Loch Nyora Poowong Wonthaggi	1	4	27	44	65	0
Leongatha	Leongatha Koonwarra	1	4	43	46	53	0
Meeniyan	Meeniyan	1	4	60	73	85	0
Toora	Pt Franklin Pt Welshpool Toora	1	4	28	34	39	0

\*refer to explanatory note on units in text

#### Table 32: ALKALINITY RESULTS FOR 2022-23

Water treatment plant / system	Localities supplied	Minimum sampling frequency (samples per quarter)	Total number of samples	Minimum result (mg/L as CaCO <sub>3</sub> ) *	Average result (mg/L as CaCO <sub>3</sub> ) *	Maximum result (mg/L as CaCO3) *
Devon North	Alberton	1	4	18	20	22
	Yarram					
Dumbalk	Dumbalk	1	4	30	50	78
Fish Creek	Fish Creek	1	4	30	32	33
Foster	Foster	1	4	39	42	46
Lance Creek	Cape Paterson Inverloch Korumburra Lance Creek Loch Nyora Poowong Wonthaggi	1	4	27	44	70
Leongatha	Leongatha Koonwarra	1	4	27	33	38
Meeniyan	Meeniyan	1	4	34	45	60
Toora	Port Franklin Post Welshpool Toora	1	4	44	46	47

\*refer to explanatory note on units in text

#### COMPARISON OF RESULTS FOR OTHER WATER QUALITY PARAMETERS

A comparison of results for the 2022-23 reporting period and the previous two fiscal years for water

quality parameters other than those listed in Schedule 2 of the Regulations is presented in Table 33. The comparison is based on percentage compliance with the guideline values of the Australian Drinking Water Guidelines 2011.

#### Percentage of samples compliant with health-related guidelines from the Australian Drinking Water Quality Parameter Water Guidelines 2011 2020-21 2021-22 2022-23 Arsenic 100 % 100 % 100 % Aluminium 100 % 100 % 100 % Chlorine 100 % 100 % 100 % Copper 100 % 100 % 100 % Cyanogen chloride 100 % 100 % 100 % Iron 100 % 100 % 100 % Lead 100 % 100 % 100 % 100 % 100 % 100 % Manganese 100 % Nitrate 100 % 100 % Nitrite 100 % 100 % 100 % NDMA 100 % 100 % 100 % 100 % Antimony 100 % 100 % Barium 100 % 100 % 100 % Beryllium 100 % 100 % 100 % Boron 100 % 100 % 100 % Cadmium 100 % 100 % 100 % **Chloroacetic acid** 100 % 100 % 100 % Chromium 100 % 100 % 100 % Cyanide 100 % 100 % 100 % **Dichloroacetic acid** 100 % 100 % 100 % Mercury 100 % 100 % 100 % Molybdenum 100 % 100 % 100 % Nickel 100 % 100 % 100 % Selenium 100 % 100 % 100 % Silver 100 % 100 % 100 % Sulphate 100 % 100 % 100 % Trichloroacetic acid 100 % 100 % 100 % Zinc 100 % 100 % 100 % 1,2-dichloroethane 100 % 100 % 100 % 2,4,5-T 100 % 100 % 100 % 2,4,6-trichlorphenol 100 % 100 % 100 % 2,4-D 100 % 100 % 100 % Atrazine 100 % 100 % 100 % Benzene 100 % 100 % 100 % Benzo(a)pyrene 100 % 100 % 100 % **Carbon tetrachloride** 100 % 100 % 100 % Clopyralid 100 % 100 % 100 % Dicamba 100 % 100 % 100 % Glyphosate 100 % 100 % 100 % МСРА 100 % 100 % 100 % Metsulfuron methyl 100 % 100 % 100 % Pentachlorphenol 100 % 100 % 100 % Picloram 100 % 100 % 100 % Simazine 100 % 100 % 100 % Tetrachloroethene 100 % 100 % 100 % Triclopyr 100 % 100 % 100 % Gross Alpha Activity \* Not monitored 100 % Not monitored **Gross Beta Activity\*** Not monitored 100 % Not monitored

#### Table 33: THREE-YEAR COMPARISON OF PERCENTAGE SAMPLES COMPLIANT WITH HEALTH-RELATED ADWG GUIDELINES

\*Radionuclides are monitored every 5 years.

#### 7. COMPLAINTS RELATING TO WATER QUALITY FOR 2022-23

#### 7.1 Complaint overview

South Gippsland Water (SGW) records and attends to all complaints relating to drinking water quality to ensure the highest level of customer satisfaction. Table 34 displays the five complaint types and the number of complaints received for each type over the 2022-23 year. Determination of the number of complaints per 100 customers supplied is based on the number of complaints compared with the total number of connected properties.

Complaints are broken down into complaint type per locality and supply system in Table 35. A comparison of the number complaints with that of the previous three reporting periods is provided in Table 36.

#### Table 34: NUMBER OF CUSTOMER COMPLAINT FOR 2022-23

Type of complaint	Number of complaints	Number of complaints per 100 customers (connected properties) supplied
Colour/sediment	14	0.06
Taste and/or odour	15	0.07
Air in water	6	0.03
Suspected illness & health concerns	1	0.00
Other	3	0.01
Total complaints	39	0.17

#### Table 35: CUSTOMER COMPLAINTS PER COMPLAINT TYPE AND LOCALITY FOR 2022-23

Water treatment plant /	Water sampling		Co	mplaint categ	ory		Total	Total complaints
supply system	locality	Colour /sediment	Taste /odour	Air in water	Health concerns	Other	complaints per locality	per supply system
	Alberton	0	0	1	0	0	1	
Devon North	Yarram	0	0	1	0	0	1	2
Dumbalk	Dumbalk	0	0	0	0	0	0	0
Fish Creek	Fish Creek	1	0	0	0	0	1	1
Foster	Foster	3	2	0	0	0	5	5
	Cape Paterson	0	0	0	0	0	0	
Lance Creek (southern	Inverloch	1	1	2	0	1	5	
towns)	Lance Creek	0	0	0	0	0	0	
	Wonthaggi	2	5	2	0	1	10	
	Korumburra	1	1	0	0	1	3	20
Lance Creek (northern	Loch	0	1	0	0	0	1	-
towns)	Nyora	1	0	0	0	0	1	
	Poowong	0	0	0	0	0	0	
1	Koonwarra	1	1	0	0	0	2	_
Leongatha	Leongatha	1	2	0	1	0	4	6
Meeniyan	Meeniyan	0	1	0	0	0	1	1
	Port Franklin	0	1	0	0	0	1	
Toora	Port Welshpool	3	0	0	0	0	3	4
	Toora	0	0	0	0	0	0	
Total complaints per categ	ory	14	15	6	1	3	39	39

#### Table 36: COMPLAINTS COMPARISON OF 2022-23 WITH THE PREVIOUS TWO REPORTING PERIODS

Type of complaint	Number of Complaints		Comparison with	Comments	
	2020-21	2021-22	2022-23	previous reporting periods	
Colour/sediments	50	28	14	Moderately significant decrease	Decline for 2022-23 and downward trend from 2020-21 reflects sustained manganese control at WTPs and an absence of majorly disruptive water main breaks (which can account for elevated level in 2020). Decline can also be attributed to on-going proactive mains flushing programs.
Taste/odour	17	11	15	No significant change	Sustained low level of complaints over the 3-year period from 2020-21 can be attributed to improved ability to mitigate the effects of algal blooms in Lance Creek Reservoir. This includes use of supplemental supply from Melbourne water grid, and improved treatment technologies. Water network cleaning programs have also contributed to low complaint level for 2022- 23.
Air in Water	4	3	6	No significant change	Sustained low level of complaints for air in water. Complaints received followed water mains break repair and planned works.
Health concerns	1	4	1	No significant change	Category includes reports of gastrointestinal illness as well as general queries re water quality and health concerns.
Other	9	5	3	Slight downward trend from 2020-21. No significant change from 2022-23	Complaints in this broad category include problems with aquatic animal pets and corrosion of internal household plumbing or appliances. While often beyond the control and responsibility of SGW, the complaints are recorded and actioned as appropriate.
Total	81	51	39	Moderately significant decrease	See above comments and "Management of complaints" discussion on following pages.

#### 7.2 Management of complaints

#### COLOUR / SEDIMENT

Colour / sediment complaints relate to problems with the clarity of water. Tap water containing sediments or particles and is coloured yellow, brown or blackish hues may be reported as "dirty water" by the customer. The particles and colour are produced by manganese and other mineral oxides rather than what might commonly be referred to as "dirt" (i.e. soil, mud, sewerage), but the overall effect is that water appears dirty and is unacceptable to the customer.

Complaints in this category also include reports of stained laundry items which may result from oxidation of minerals in contact with laundry detergents in a washing machine.

Colour / sediment complaints primarily result from:

- High manganese levels in source waters. The soil in the South Gippsland region is naturally high in manganese, and run-off into reservoirs and rivers is unavoidable. Not all manganese can be removed during the water treatment process so accumulation in the distribution system can occur;
- Accumulation of sediment within clear water storages and water mains over time; and/or
- Unintended scouring of water mains following high flows or recharging of the system.

Corrective actions to address colour / sediment water include:

- Use of aeration and potassium permanganate dosing systems at water treatment plants to oxidise manganese and maximise physical removal through filtration;
- Cleaning of clear water storage tanks and basins
- Implementation of scheduled air-scouring and flushing programs within all water sampling localities to remove manganese and other accumulated sediments;
- Additional flushing when required in response to individual complaints, and increased frequency of flushing regimes for problem areas.

 Provision of a commercial cleaning product which removes discolouration marks from laundry items in response to individual customer complaints.

There were 14 complaints received in relation to coloured water in the 2022-23 reporting period. The decline in complaints from 2020-21 (see Table 35) and overall low level for 2022-23 can be attributed to an absence of majorly disruptive water main breaks (that accounts for elevated level in 2020-21) and ongoing proactive mains flushing programs.

Connection of the towns of Korumburra, Poowong, Loch, and Nyora to the Lance Creek water supply system in 2018-19 can also account for an overall declining trend in colour / sediment complaints since the 2017-18 reporting period (refer to previous <u>annual</u> <u>drinking water quality reports</u> for further information). These towns were previously supplied from either the Korumburra or Poowong water treatment plants (now both decommissioned), where manganese control was challenging due to seasonal increases in source water reservoirs.

Efforts to enhance manganese control at currently operating water treatment plants is also likely to have contributed to overall decline in complaints in this category over the past five years.

#### TASTE AND ODOUR

What is considered acceptable in terms of the flavour and smell of water has some level of individual subjectivity. Some customers, for example, may object to the taste and odour of chlorine, while others receiving water with the same chlorine concentration do not. A complaint may be due to a customer's acute sensitivity to chlorine taste and odour, or the perception that chlorine is something that is undesirable to drink.

While tastes and odours in drinking water do not generally denote that water is unsafe, SGW endeavours to minimise unpleasant flavours as much as possible. This is important not only for the customer's satisfaction and enjoyment but also so that they will choose supplied tap water over other potentially less-safe or healthful forms of hydration (e.g. from a poorly-managed tank water system, or from sugary soft drinks) or options having adverse environmental impacts (i.e., purchased bottled water).

Taste and odour complaints result primarily from:

- Cyanobacterial (blue-green algal) compounds in the water;
- Manganese and/or iron sediment in the water;
- Changes in pH, dissolved oxygen, and other factors in relation to ageing of water within a water main due to low flows.
- Chlorine in water.

Corrective actions to prevent or address taste and odour issues include:

- Routine monitoring of supplied water for taste and odour, manganese, iron, turbidity, pH and chlorine;
- Analysis for taste and odour related parameters (as above) when required in response to individual complaints;
- Use of powdered activated carbon (PAC) at treatment plants to remove algae-related and other taste and odour compounds from water;
- Use of aeration and potassium permanganate dosing systems at water treatment plants to oxidise manganese and maximise removal from source waters.
- Water main flushing and air-scouring programs
- Use of supplementary supply where available (i.e., Melbourne water for Lance Creek system)

There were 15 complaints relating to taste and odour issues received from customers in the 2022-23 reporting period. The sustained low-level of taste and odour complaints in the past three years (refer to Table 36) can be largely attributed to the connection of the Lance Creek system to the Melbourne water supply grid in 2018. The ability to supply the system with 100 per cent Melbourne water has allowed the Lance Creek Reservoir to be taken completely offline when affected by cyanobacterial blooms. The capacity to blend Melbourne and Lance Creek waters has also enabled dilution of cyanobacterial taste and odour compounds in the reservoir to levels acceptable to customers.

#### AIR IN WATER

Air in water complaints are received following mains breaks, implementation of air-scour mains cleaning programs, or following other planned works on the water supply system. Air-related complaints are often reported as "white water" or "milky water". This is due to the effect of tiny air-bubbles on the appearance of the water.

Notifications delivered to customers in advance of planned works and air-scouring programs include advice to flush internal taps following scheduled conclusion of the works. This action normally resolves any potential "white water" issue. Where it cannot be resolved by the customer, mains flushing is carried out to remove air from the system.

There were six complaints involving air in water from South Gippsland Water customers in the 2022-23 reporting period. These mainly followed planned works involving valve operations and mains shutdowns.

#### SUSPECTED ILLNESS AND HEALTH CONCERNS

Customers may make a complaint if they suspect supplied tap water is the cause of illness or other conditions, such as skin or eye irritation and problems with hair. Generally-speaking a customer will call to seek reassurance with regards to water quality rather than alleging that the water is the cause of their health problem.

Customers with health concerns are encouraged to consult a medical professional for diagnosis and treatment. Depending on the nature of the complaint, additional monitoring to verify quality of drinking water supplied to the customer's residence and through the domestic plumbing system may be carried out. Details of the complaint and results of both monitoring and diagnostic testing (if provided) are recorded via an Illness Complaint Record Form.

In the unlikely event supplied drinking water was found to be a causative factor of illness, the Department of Health would be immediately notified. Further actions, which might include issue of a boil water advisory, would be implemented as a matter of the highest priority.

There was just one complaint recorded in this category for 2022-23. Investigation found no evidence of related water quality problems.

#### OTHER COMPLAINTS

Other complaints relate to concerns that are generally beyond the control and responsibility of SGW. These may include problems with aquarium fish or garden plants, and issues with domestic plumbing or appliances.

In response to such complaints, results of monitoring programs that may be relevant are reviewed, and additional investigation and sampling is carried out where appropriate. Customers are informed of the likelihood of supplied water being the cause of the problem and given advice on where to seek additional assistance if required. There were only three complaints in this category in the 2022-23 reporting period.

#### 8. FINDINGS OF THE MOST RECENT RISK MANAGEMENT PLAN AUDIT

#### AUDIT OVERVIEW

Under section 7 of the *Safe Drinking Water Act 2003* (the Act), a water supplier is required to prepare, implement, and review a risk management plan for the supply of drinking water to the public. The plan must be audited by an approved external auditor periodically as directed by the Department of Health.

Pursuant to the above, an audit of South Gippsland Water's drinking water risk management plan (RMP) was conducted in March 2023. The audit period was defined as 1 January 2021 to 31 December 2022. Audit outcomes are discussed briefly below.

#### AUDIT FINDINGS

As noted on the audit certificate (see Appendix B), the auditor found that South Gippsland Water has complied with the obligations imposed by section 7(1) of the Act during the audit period. This result confirms on-going SGW compliance with requirements of the Act with respect to drinking water risk management plans.

A detailed audit report was provided, and while no non-conformities were recorded, the auditor identified five opportunities for improvement (OFIs) for SGW consideration; these are as follows:

- Put in place measures to help prevent outdated hard copies of RMP documentation being present at WTPs (water treatment plants), depots, and offices.
- Formalise how reagents that have gone past their minimum recommended shelf life can have their agreed expiry dates extended, or have the reagents repurposed for non-critical uses, or discarded.
- Consider the value of introducing a carbon dosing system to permit powdered activated carbon dosing at the Devon North WTP.
- Serious consideration should be given to full replacement of all basins relying on legacy floating cover arrangements with modern, conventional treated water storage tanks.
- Check whether there were parts or fittings that do not bear the ("W") watermark and if so to remove them from use for potable water works.

South Gippsland Water has actioned or prioritised OFIs for future review, as deemed appropriate. The audit certificate and an OFI progress summary is provided in Appendices B and C, respectively. A progress summary from the previous audit in 2020 is also provided in Appendix D.

#### 9. REGULATED WATER

Regulation 16 of the Safe Drinking Water Regulations 2015 requires details of regulated water supplied be included in this annual report. Regulated water is defined as "water that is not intended for drinking but could reasonably be mistaken as drinking water". South Gippsland Water did not supply any regulated water in the 2022-23 reporting period. Appendix A: drinking Water Quality Policy

# Drinking Water Quality Policy



### "Committed to high-quality drinking water"

South Gippsland Water is committed to providing safe, high-quality drinking water that consistently meets accepted standards, guidelines, regulatory requirements, and customer expectations. To achieve this, in partnerships with stakeholders and relevant agencies, the Corporation will:

- Manage water quality at all points along the delivery chain from source water to consumer;
- Use a risk-based approach to identify and manage potential threats to water quality;
- Continually assess the quality of drinking water through appropriate monitoring programs and effective reporting systems;
- Develop appropriate contingency planning and incident response capability;
- Integrate into our planning the needs and expectations of customers, stakeholders, regulators, and employees;
- Continually improve our management systems by assessing performance against industry best practice, corporate commitments, and stakeholder expectations;
- Participate in appropriate research and development activities to ensure continued understanding of drinking water quality issues and performance;
- Contribute to the debate on setting industry regulations and guidelines, and other standards relevant to public health and the water cycle.

The Corporation will implement and maintain a drinking water quality management system consistent with the NHMRC, NRMMC *Australian Drinking Water Guidelines*<sup>\*</sup> *to* effectively manage risks to drinking water quality.

All managers and employees involved in the supply of drinking water are responsible for understanding, implementing, maintaining, and continuously improving the drinking water quality management system.

This Drinking Water Quality Policy is proudly displayed at South Gippsland Water facilities and is communicated to all persons working for or on the Corporation's behalf during induction or contract proceedings. The Policy is available to the public upon request or via the South Gippsland Water website. Contact details are: –

South Gippsland Water 14-18 Pioneer Street PO Box 102 Foster, Victoria 3960 (03) 5682 0444

or: sgwater@sgwater.com.au

Phil Clark Chair

Date: 20 March 2022

Philippe du Plessis Managing Director

Date: 20 March 2022

<sup>\*</sup> NHMRC, NRMMC (2011) Australian Drinking Water Guidelines Paper 6 National Water Quality Management Strategy. National Health and Medical Research Council, National Resource Management Ministerial Council, Commonwealth of Australia, Canberra

## Risk management plan audit certificate

Certificate Nun	nber: 199
Audit pe	riod: 1 January 2021 to 31 December 2022
o: Sarah Salm	ons, Water Quality Coordinator
South Gipps	sland Water, PO Box 102, Foster, Vic 3960
Australian Business Nu	umber (ABN): 40 349 066 713
Dr Daniel Dee	re , after conducting a risk management plan audit of
he water supplied by	South Gippsland Water am of the opinion that -
South Gippsla	nd Water has complied with the obligations
imposed by se	ection 7(1) of the Safe Drinking Water Act 2003 during the audit period.
Signature of approved	auditor: MADeeje Date: 29 April 2023
Department of Heal	th

Safe Drinking Water Regulations 2015 - Regulation 10

V

Арреі	pendix C: Progress summary for 2023 drinking water Risk Management Plan Audit							
Item	Opportunity for improvement (OFI)	Target completion date	OFI status as of Sept 2023	Action progress as of Sept 2023	Comments			
1.	Put in place measures to help prevent outdated hard copies of RMP documentation being present at WTPs, depots, and offices.	Dec 2023	Open	In progress	Notifications of updated documents are to emphasise direction to discard outdated hardcopy versions. Regular internal auditing at water treatment plant laboratories, including checks of hardcopy documentation is being added to operator task lists in WIMS (Water Information Management System).			
2.	Formalise how reagents that have gone past their minimum recommended shelf life can have their agreed expiry dates extended, or have the reagents repurposed for non-critical uses, or discarded.	Dec 2023	Open	In progress	Reagents will no longer be ordered in bulk or large volumes. Regular internal auditing at water treatment plant laboratories, including checking of expiry dates, is being added to operator task lists in WIMS (Water Information Management System).			
3.	Consider the value of introducing a carbon dosing system to permit powdered activated carbon dosing at the Devon North WTP.	Dec 2023 (consideration)	Open	In progress (consideration)	Feasibility and value with respect to infrequency of algal blooms at Devon North is being assessed.			
4.	Serious consideration should be given to full replacement of all basins relying on legacy floating cover arrangements with modern, conventional treated water storage tanks.	Sep 2023 (consideration)	Closed	OFI to be given (long-term) future consideration	After thorough consideration, including industry consultation and risk assessment, SGW has carefully weighed the pros and cons of both floating cover basins and modern treated water storage tanks. While installation of tanks of equal volume capacity to existing basins would involve significant upfront costs, at least ten times more than the ongoing long-term refurbishment of existing basin linings and covers, SGW experience indicates they would still require a comparable level of inspection and maintenance. Additionally, they may be more vulnerable to the effects of climate change, such as volatile weather and rising temperatures than in-ground basins. SGW will continue to manage the risks associated with floating covers as it has historically. Into the future, this approach may involve greater reliance on specialised external contractors to mitigate perceived occupational health and safety risks and more frequent sampling in response to climate-change related temperature shifts. It's worth noting that SGW has recently replaced liners and floating covers of four basins and will complete refurbishment of the 5th and final basin in 2024-25. Going forward, SGW will closely monitor the industry landscape throughout the lifespan of the new covers (15 to 25 years) for water quality issues related to basins and evolving best practices. This information will inform SGW future consideration of the auditor's recommendation.			
5.	Check whether there are parts or fittings that do not bear the (W) watermark and if so to remove them from use for potable water works.	Sep 2023	Closed	Complete	Work Orders for Maintenance Team Leaders and Stores Officers to audit depot sites for non-watermarked items. All work orders complete.			

#### Appendix C: Progress summary for 2023 drinking water Risk Management Plan Audit

Item	Opportunity for improvement (OFI)	To be implemented	Target completion date	OFI status as of September 2023	Action progress	Comments
1.	Consideration could be given to the possible value of roofing of the (Leongatha) WTP infrastructure to improve ease of maintenance and asset life and reduce slime formation.	To be determined	Aug 2024 (consideration)	Open	Further consideratio n of OFI in progress.	Has been considered in 2023 pricing plan. Leongatha clarifier roofing is being further considered as part of renewal and upgrades program for 2024 with respect to feasibility, budget, scope, and costs.
2.	SGW could consider means to keep analytical instrumentation reagents and standards within their appropriate operating temperature range and seek to minimise variations in that temperature.	Not applicable	Not applicable	Closed	No action required.	Brick analyser shed at Lance Creek WTP is already installed. OFI is based on a misunderstanding during the audit (likely due to social distancing and masking rules at the time). Operator was speaking of issues with operating temperatures previous to construction of shed.
3.	SGW may wish to keep track of emerging issues relating to microbial pathogens and disinfection by- products given its continuing use of floating covers rather than conventional tanks.	Yes	On-going	Closed	OFI noted for long- term action	SGW will keep abreast of emerging issues via on-going review of relevant publications and attendance at seminars, etc. Monitoring of basins is already in place.
4.	SGW could more clearly label some of its sampling points to help reduce the risk of misunderstanding when samples are collected.	Yes	Dec 2022	Closed	Works complete	An audit of existing signage was conducted. Metal signage tags have been installed where required. Sampling staff also undergo training and internal auditing to ensure competency. They are also provided with sampling site guidebooks, which are updated regularly.
5.	Where parts and fittings are being stored, SGW could consider providing sufficient space under cover to protect parts and fittings from potential UV degradation.	Yes	Aug 2024	Open	Works in progress	Intended works were added to Interim Facilities project for instalment of additional storage shelters. Additional capacity for parts and fittings achieved through reorganization of existing storage outlays and renovation of shelving. Shelter still required for pipe lengths at Wonthaggi Depot. Works are in the process of being quoted but may not commence until 2024.
6.	SGW could consider adding some clear signage on the temporary potable water tanker	Yes	Dec 2021	Closed	Works complete	Signage of all temporary water trailers complete.
7.	SGW could consider some formal resilience planning to provide safe water for systems that do not have a backup water supply feed to protect the supply of safe water in the event of untreatable source water contamination or treatment system failure (e.g. Leongatha that is a large system with limited contingency).	Yes	April 2022	Closed	Resilience planning complete.	Resilience planning included in SGW's Urban Water Strategy (UWS). The UWS is a state-required 50-year strategy for water and waste- water services that recognizes the variables and future impacts of climate change and growth. The UWS process completed and report produced April 2022, in alignment with DELWP/DEECA guidelines. Resilience assessments were undertaken for each system. Systems found to be either resilient or small enough for water to be supplied by tanker in an emergency. Contingency planning and work with respect to clear water storages and bypasses is on-going. Filter and clarifier upgrades for enhanced treatment are under consideration.

### Appendix D: Progress summary for 2020 drinking water risk management plan audit

Aluminium chlorohydrate	Aluminium salt used as a coagulant in water treatment
Aluminium sulphate	Aluminium salt used as a coagulant in water treatment
Chloramine	A compound of chlorine and ammonia used for disinfection
Chlorine	An element used as a disinfectant in water treatment. May be applied in gaseous, elemental form, or via aqueous solution of sodium hypochlorite.
Coagulation	A chemical water treatment process that involves neutralisation of ionic charge on particles (impurities) in water. This destabilisation of charge allows for particles to come together (coagulate rather than repel each other electrostatically. This leads to the formation of small fluffy, flake-like masses.
Dewatering of wastewater	Method of post water treatment water conservation. Removes excess water from sludge so it can be returned to a reservoir and reused.
Disinfection	Use of chemical, other agent (e.g. ultraviolet light) or process to kill or inactivate microorganisms which may be harmful to human health.
Dissolved air floatation (DAF) clarification	Water treatment process involving use of pressurised air for clarification. Microscopic air bubbles attach to floc and cause it to float and form a sludge layer. This allows for separation of impurities (as floc) from water.
Filtration	Final water treatment process prior to disinfection; clarified water passes through large filters where impurities are entrapped.
Flocculation	A physical water treatment process that causes flake-like particle aggregates (formed through coagulation processes) to come together into larger masses known as floc. Formation of floc allows for purification of water via sedimentation and filtration processes.
Fluoridation	Addition of fluoride to water for public dental health purposes.
Granular medium	Layers of sand, gravel and crushed anthracite that make up a water treatment plant filter.
Hydrochloric acid	An acid used to lower the pH of water which enables optimisation of coagulation processes
Manganese oxidation	Water treatment process important for minimising dirty/coloured water complaints. Oxidation of dissolved manganese in raw (source) water causes it to precipitate out of solution as a solid. This is in turn allows for the solid oxidised manganese particles to be removed via coagulation, flocculation and filtration processes.
Manganese sequestration	Process that may be used to mitigate post treatment manganese oxidation and resulting discolouration of water. Manganese that has not been removed in treatment may oxidise on contact with chlorine disinfectants or air. Sequestration (or chelation) causes manganese to form soluble complexes that do not cause discolouration of water.
pH correction (pre/post treatment)	Raw water pH can vary due to environmental factors. Pre pH correction is needed to optimise treatment processes. Post pH treatment may be required to ensure pH is suitable for disinfection, and for distribution to customers in terms of aesthetics and water stability.
Polyacrylamide	Chemical polymer which may be used to facilitate flocculation or dewatering processes. Acts by binding particles/floc together.
Potassium permanganate	Compound used to oxidise manganese
Powdered activated carbon (PAC)	Primarily used to adsorb taste and odour compounds produced by algae from raw water
Sedimentation clarification	A physical water treatment process using gravity to remove suspended solids from water
Sodium hydroxide	Base used to raise the pH of water and optimise coagulation pH levels.
Ultraviolet disinfection	Use of ultraviolet light to kill/inactivate water-borne microorganisms that may be harmful to human health.

Appendix F: Glossary of acronyms and terms used in report		
ADWG	Australian Drinking Water Guidelines 2011; published by the National Health and Medical Research Council	
CFU (or cfu)	Colony-forming unit. A quantifier used in microbiology. One visible microbial colony on a growing medium (agar plate or other) represents one microbial cell in the original sample. May be expressed as CFU per unit volume of sample (e.g., 1 CFU/100mL)	
CWS	Clear water storage: A tank or basin that contains and protects water that is safe to drink	
Coliforms	A general term for certain types of rod-shaped bacteria that share identifying characteristics.	
Cyanobacteria	Photosynthetic aquatic bacteria commonly referred to as 'blue-green algae' (though not actually algae).	
DWMS	Drinking Water Management System	
'the department' Department of Health (State Government of Victoria)		
E. coli	Escherichia coli: thermotolerant bacteria used as an indicator of faecal contamination	
НАССР	Hazard Analysis and Critical Control Point	
НВТ	Health based targets: measurable health, water quality or performance objectives that are established based on a judgement of safety and on risk assessments of waterborne hazards	
<	'Less than' (mathematical term)	
>	'Greater than' (mathematical term)	
≤	'Less than or equal to' (mathematical term)	
L	Litre: a unit of volume equal to 1000 cubic centimetres	
mg/L	Milligrams per litre: a unit of concentration (one milligram is equal to 0.001 grams)	
ML	Megalitres: a unit of volume (one megalitre is equal to one million litres)	
NATA	National Association of Testing Authorities	
ng/L	Nanograms per Litre: a unit of concentration (one ng is equal to 0.000000001 grams)	
NHMRC	National Health and Medical Research Council	
OFI	Acronym for "opportunity for improvement" as noted in audit reports	
Pathogen	Disease-causing microorganism (bacteria, viruses, protozoa or fungi)	
PAC	Powdered activated carbon	
PLC	Programmable logic controller: a digital computer used for automation of electromechanical processes	
Potable water	Water that is safe to drink	
PVC-EIA	Polyvinyl chloride – Ethylene interpolymer alloy: Geomembrane material for linings and coverings	
Quarter	Time period referring to one quarter of a year, <i>i.e.</i> three months.	
Raw water	Untreated source water (from a river, creek or reservoir). Non-potable (unsafe) water	
RMP	Risk Management Plan	
'the Act'	Safe Drinking Water Act 2003	
'the Regulations' Safe Drinking Water Regulations 2015		
SGW	South Gippsland Water (South Gippsland Region Water Corporation, 'the Corporation')	
Turbidity	A measure of the cloudiness of water due to suspended solids	

